

General Information

Date & Time: 04, Jul, 2025 13:38

Make	Suzuki	Model	Swift
YOM	2018	Odo Meter Reading	45,942
Registration No.	NAK7954	Chassis No.	MA3ZC6SXXKAD97844
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



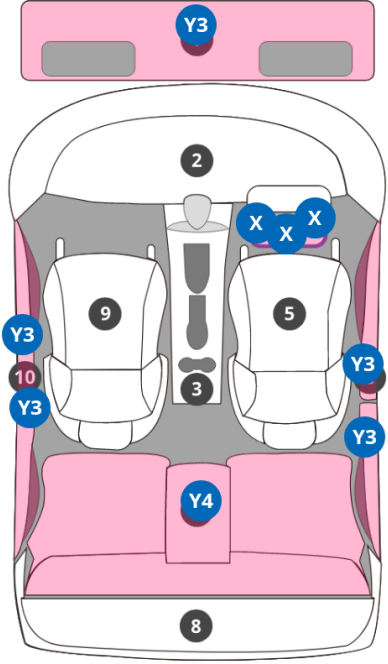
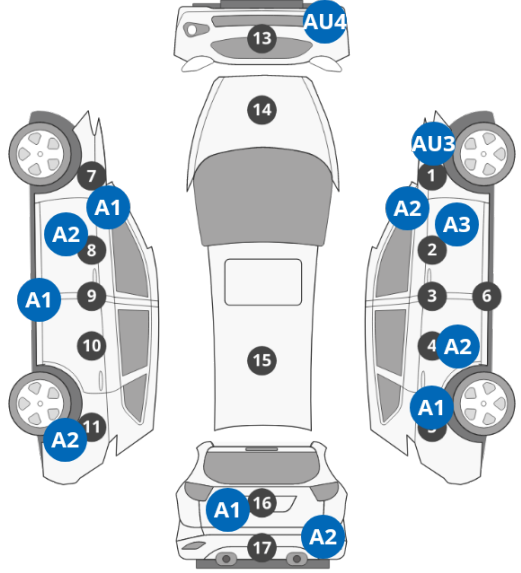
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	185.3	188	185	183
2	Boot Lid	244.3	236	209	288
3	Roof	124.7	125	135	124/115
4	Left Front Fender	233.0	248	225	226
5	Left Front Door	172.6	159	175	184
6	Center Panel Left				
7	Left Rear Door	172.0	199	159	158
8	Left Back Panel	224.6	197	293	184
9	Right Front Fender	380.6	383	374	385
10	Right Front Door	200.0	213	186	201
11	Center Panel Right				
12	Right Rear Door	273.6	207	218	396
13	Right Back Panel	234.0	211	229	262

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Gap at front bumper. With warranty booklet and spare tire. without jack and tools. 1 key. With LTO plate.</p>