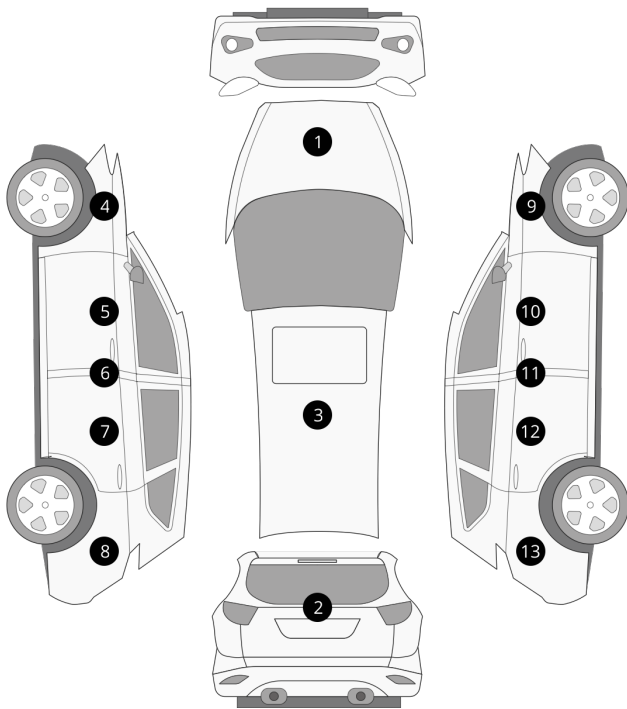


General Information

Date & Time: 01, Jul, 2025 16:08

Make	Mazda	Model	Mazda 2
YOM	2016	Odo Meter Reading	84,555
Registration No.	NDH7537	Chassis No.	MM7DL2SAAGW151214
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



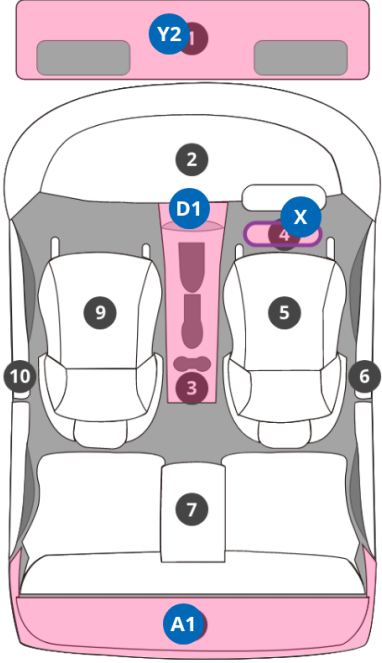
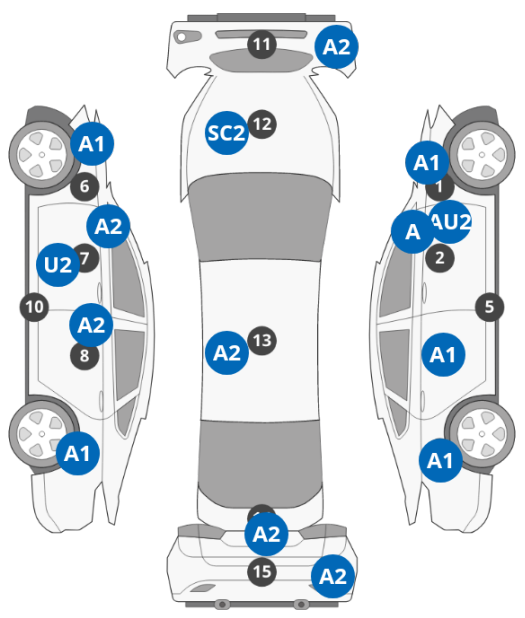
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	211.0	209	213	211
2	Boot Lid	105.6	102	103	112
3	Roof	102.5	95	98	106/111
4	Left Front Fender	123.0	124	106	139
5	Left Front Door	214.0	212	212	218
6	Center Panel Left				
7	Left Rear Door	228.0	243	205	236
8	Left Back Panel	180.6	200	169	173
9	Right Front Fender	247.6	248	234	261
10	Right Front Door	181.0	201	161	181
11	Center Panel Right				
12	Right Rear Door	162.0	161	151	174
13	Right Back Panel	159.3	149	147	182

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (R) Front Floor Mat - Missing - Yes / Console, Switches, Vents - Loose, Deformed - Minimal / Ceiling - Grime - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / Overall Exterior - Worn as per age - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch, Peeled - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Rust, Corrosion - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with LTO plate, no warranty booklet, with jack and tools, with spare tire, faded headlights , busted fog lamps, air-conditioning vent damaged