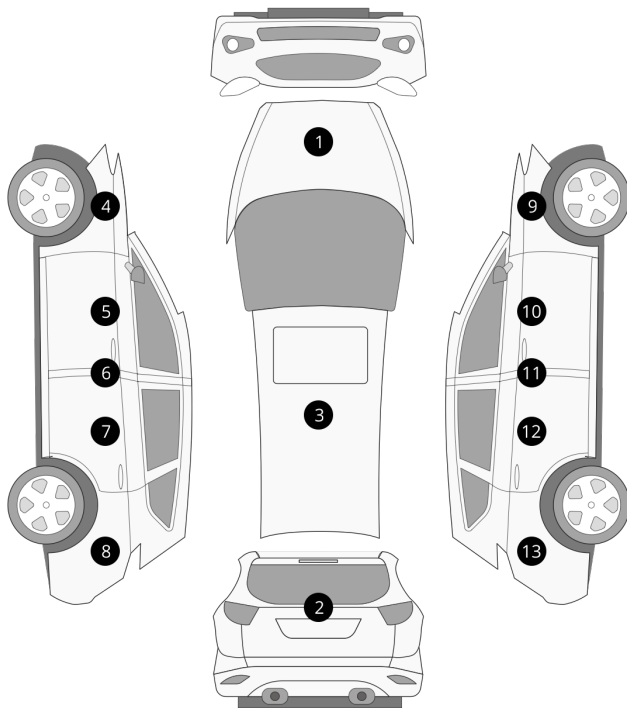


General Information

Date & Time: 16, Jul, 2025 13:17

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	30,702
Registration No.	NFI6813	Chassis No.	PA1B18F35M4163378
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



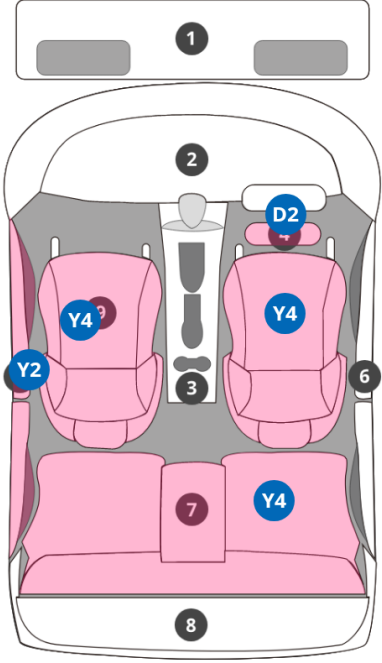
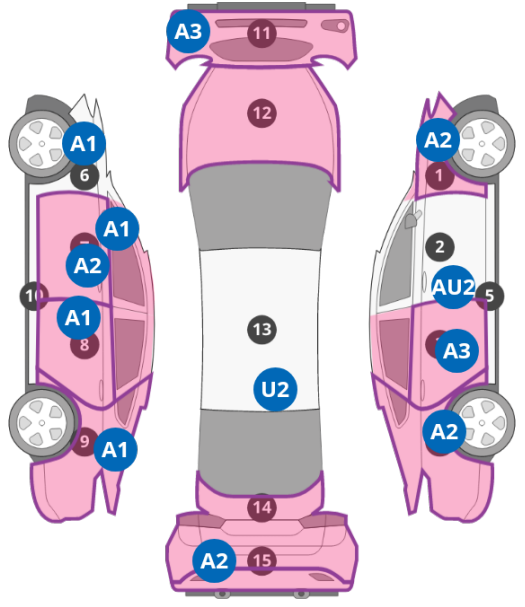
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	87.1	84	88	90
2	Boot Lid	111.6	110	117	108
3	Roof	99.5	93	90	119/96
4	Left Front Fender	89.2	88	89	91
5	Left Front Door	90.6	90	92	90
6	Center Panel Left				
7	Left Rear Door	109.5	90	119	120
8	Left Back Panel	118.0	123	123	108
9	Right Front Fender	87.4	88	86	89
10	Right Front Door	99.4	96	98	104
11	Center Panel Right				
12	Right Rear Door	95.3	93	95	98
13	Right Back Panel	107.3	105	111	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / Mat Other - Worked - Small / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Trim - Grime - Small	Remarks (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Small / Bonnet, Headlight - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, no jack, incomplete tools, with spare tire, coolant leak on reservoir