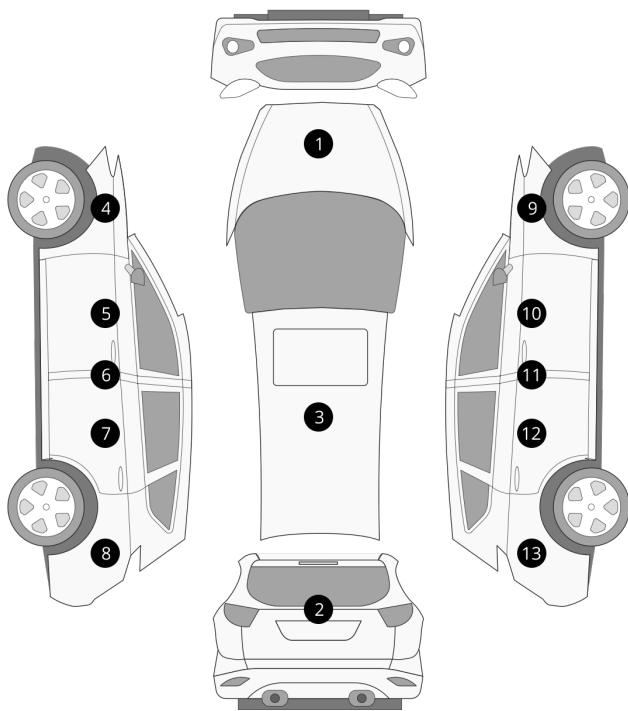


General Information

Date & Time: 04, Jul, 2025 10:34

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	155,637
Registration No.	NEF9149	Chassis No.	JTFJT02P6L5025635
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



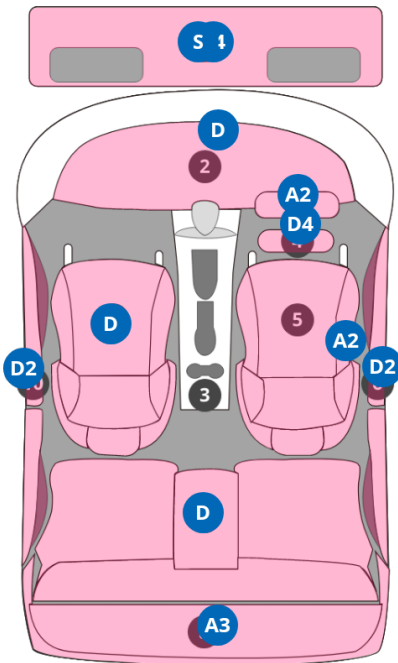
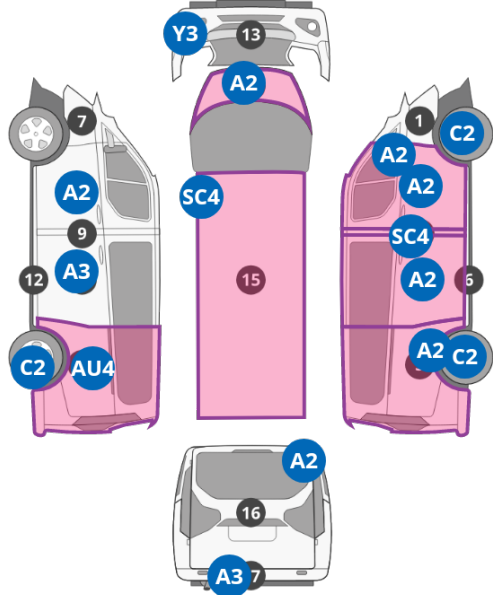
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	156.0	161	135	172
2	Boot Lid	142.6	165	133	130
3	Roof	289.5	741	167	119/131
4	Left Front Fender	187.3	197	182	183
5	Left Front Door	124.6	127	115	132
6	Center Panel Left	128.3	157	113	115
7	Left Rear Door	73.8	76	73	73
8	Left Back Panel	74.6	73	73	78
9	Right Front Fender	130.0	126	135	129
10	Right Front Door	107.0	100	121	100
11	Center Panel Right	208.6	179	278	169
12	Right Rear Door	208.6	152	164	310
13	Right Back Panel	85.0	84	84	87

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Worn - Yes / Ceiling - Grime - Large / (R) Front Seat - Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Medium / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Large / Glove Box - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Seat - Worn - Yes / Dashboard - Traces of Adhesive Tape - Yes	Remarks Front Panel - Replaced - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / (R) Center Panel - Replaced - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Rust, Corrosion - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / Roof - Rust, Corrosion - Large / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Front Panel - Scratch - Small
Frame Evaluation : D	Functional Evaluation : C
Remarks Right Front Pillar - Condition of Welding ? - Yes	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate, no warranty booklet, with jack, incomplete tools, with spare tire, timing belt lamp on, worn tires, replaced right ceiling handle