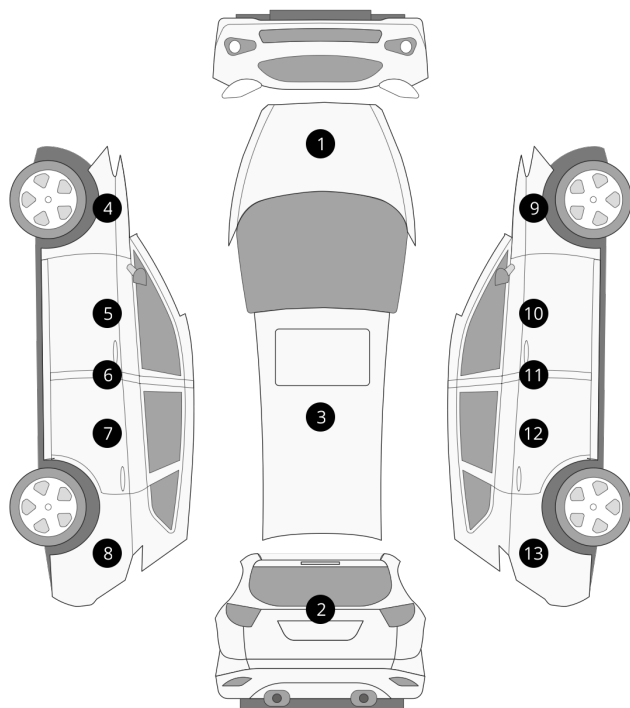


General Information

Date & Time: 08, Jul, 2025 12:47

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	97,276
Registration No.	DAQ5921	Chassis No.	PA1B18F37N4175758
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



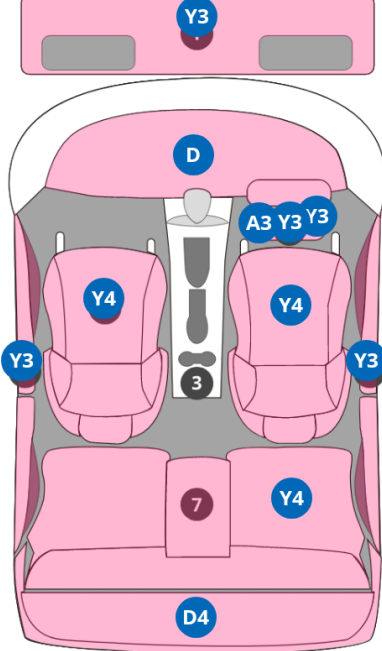
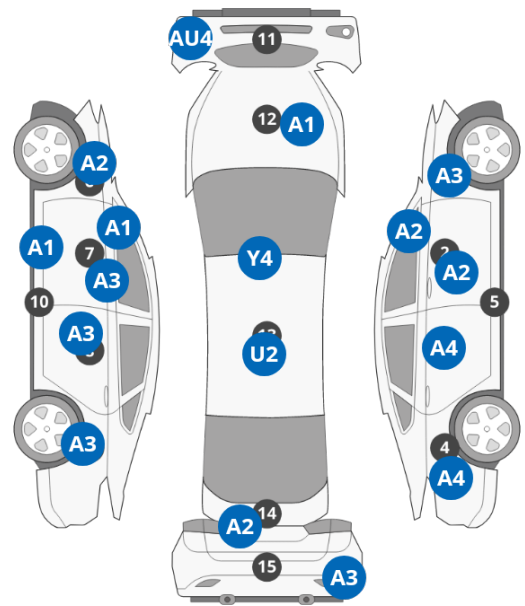
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	111	108	112
2	Boot Lid	147.0	152	135	154
3	Roof	94.7	99	91	97/92
4	Left Front Fender	101.6	99	106	100
5	Left Front Door	105.8	111	108	99
6	Center Panel Left				
7	Left Rear Door	106.0	106	105	107
8	Left Back Panel	109.6	132	96	101
9	Right Front Fender	97.9	97	100	97
10	Right Front Door	101.3	100	106	98
11	Center Panel Right				
12	Right Rear Door	101.9	100	99	107
13	Right Back Panel	101.6	100	97	108

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Loose, Deformed - Large / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Cut, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Dent - Small / Front Windshield - Damaged - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Crack Windshield. Possible flooding. With warranty booklet,jack,tools and seat cover. Spare tire wheel not installed at mags. 1 key. With LTO plate