

## General Information

Date & Time: 07, Jul, 2025 17:47

<b>Make</b>	Nissan	<b>Model</b>	NV350
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	102,811
<b>Registration No.</b>	NEA5352	<b>Chassis No.</b>	JN1TC2E26Z0052399
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	White		

## Body / Panel Condition



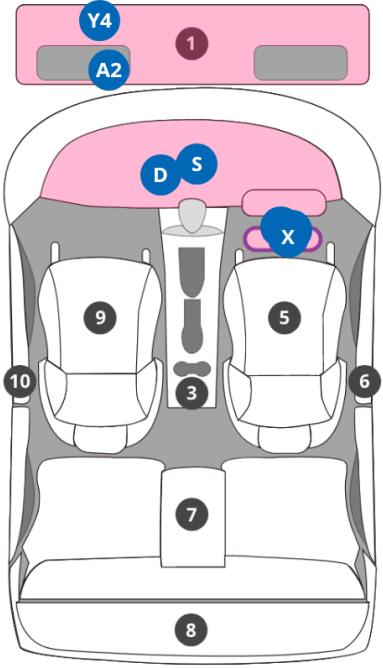
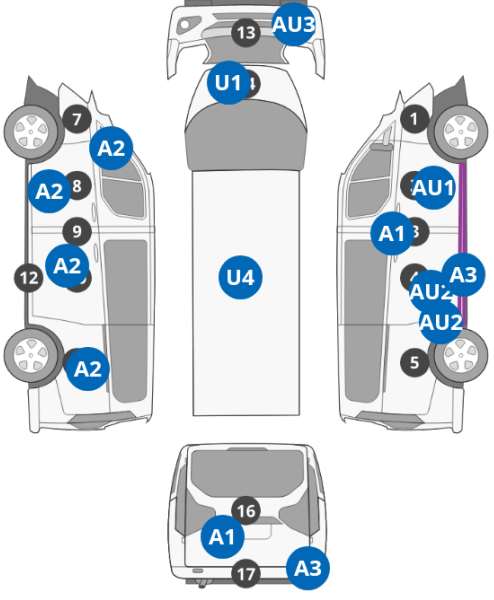
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	332.6	155	706	137
2	Boot Lid	144.6	147	143	144
3	Roof	75.8	76	72	70/85
4	Left Front Fender	82.0	82	83	82
5	Left Front Door	93.3	92	96	92
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	82.2	81	88	78
9	Right Front Fender	80.4	81	82	79
10	Right Front Door	69.5	65	70	74
11	Center Panel Right	73.6	74	80	67
12	Right Rear Door	76.5	72	80	77
13	Right Back Panel	78.3	77	81	77

**Overall Evaluation :**

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> Front Panel - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Center Panel - Scratch - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Front Panel - Dent - Minimal / Roof - Dent - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Seat Belts - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on headlight and tail light, park light issue, air-conditioning system issue</p>