

General Information

Date & Time: 07, Jul, 2025 16:53

Make	Suzuki	Model	Ertiga
YOM	2016	Odo Meter Reading	75,200
Registration No.	ECR2030	Chassis No.	MA3ZE81S0G0349089
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



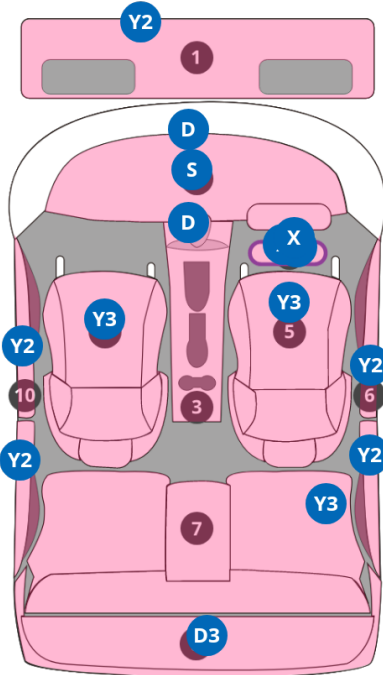
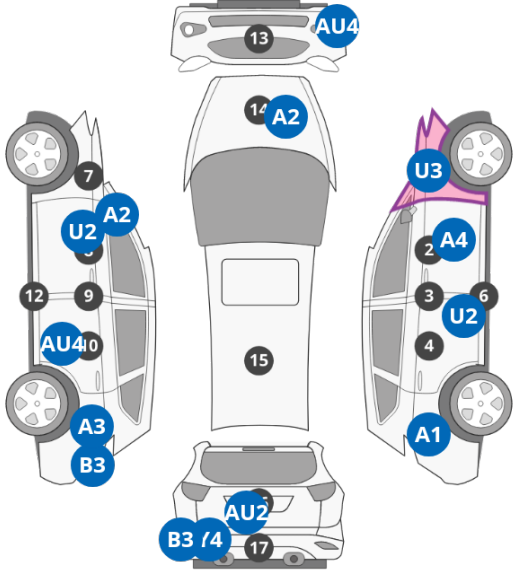
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	180.0	199	166	175
2	Boot Lid	237.6	268	231	214
3	Roof	104.8	99	102	112/107
4	Left Front Fender	245.0	238	243	254
5	Left Front Door	250.0	389	163	198
6	Center Panel Left				
7	Left Rear Door	188.3	269	143	153
8	Left Back Panel	207.3	229	191	202
9	Right Front Fender	263.6	312	241	238
10	Right Front Door	218.6	287	178	191
11	Center Panel Right				
12	Right Rear Door	312.0	365	239	332
13	Right Back Panel	220.6	225	210	227

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Trunk Room - Loose, Deformed - Medium / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Modified - Medium / (L) Rear Fender, Molding - Modified - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Dent - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Front Wheel, Cover - Cap Missing - Yes / Overall Exterior - Color Change - Yes</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratched and suncrack tail lights and headlight, plate light issue, turn signal/hazard issue, front right window issue, overall exterior repainted (changed color) , all floormat missing, seatbelt issue</p>