

General Information

Date & Time: 09, Jul, 2025 09:47

Make	Mitsubishi	Model	Mirage
YOM	2017	Odo Meter Reading	99,685
Registration No.	NAR9547	Chassis No.	MMBSTA13AHH006565
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



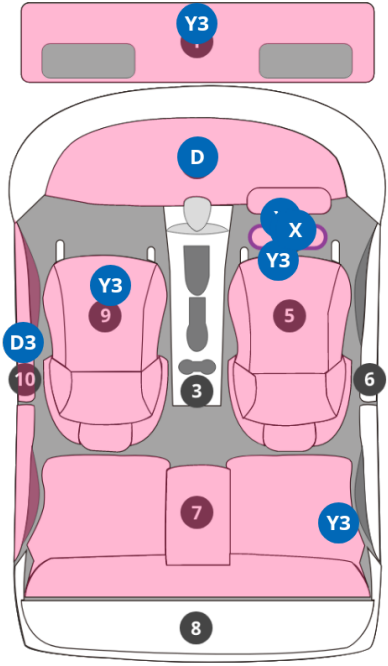
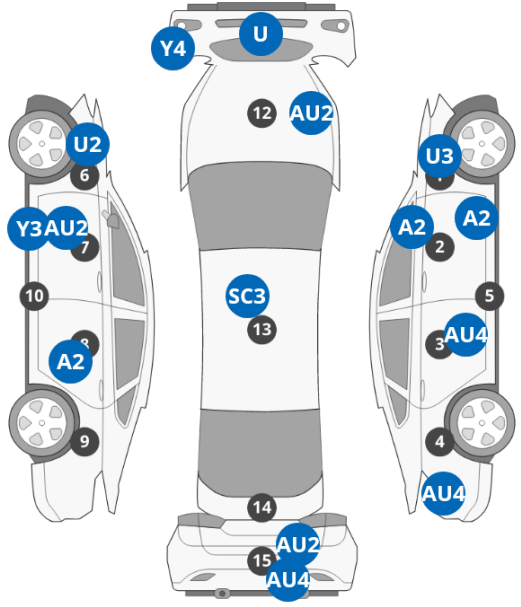
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	350.6	246	457	349
2	Boot Lid	210.3	204	208	219
3	Roof	187.7	208	165	204/174
4	Left Front Fender	289.6	366	357	146
5	Left Front Door	227.6	207	211	265
6	Center Panel Left				
7	Left Rear Door	253.6	246	251	264
8	Left Back Panel	197.0	161	264	166
9	Right Front Fender	243.6	184	185	362
10	Right Front Door	84.7	90	85	79
11	Center Panel Right				
12	Right Rear Door	98.4	121	88	86
13	Right Back Panel	92.0	93	83	99

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
	
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Loose, Deformed - Medium / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Crack, Gap - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / Roof - Rust, Corrosion - Medium</p>
Frame Evaluation : D	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Condition of Welding ? - Yes</p>	<p>Remarks Air Conditioner - Function - Weak / Remote Key & Smart entry - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, uneven engine hood, abnormal noise on left front door, air-conditioning system issue, fog lamps issue</p>