

General Information

Date & Time: 14, Jul, 2025 14:29

Make	Subaru	Model	Outback
YOM	2016	Odo Meter Reading	106,647
Registration No.	NCH6270	Chassis No.	JF1BS9LC2GG070066
CC	3.6	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



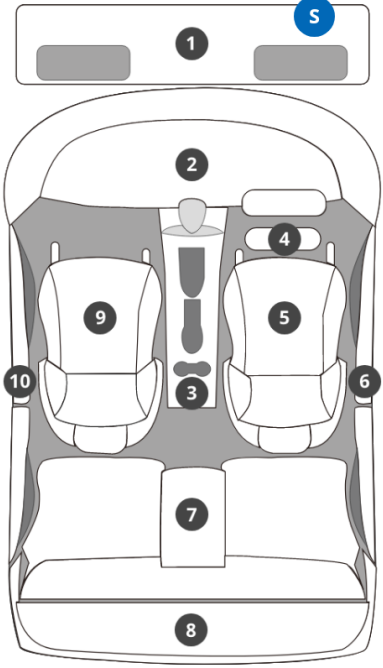
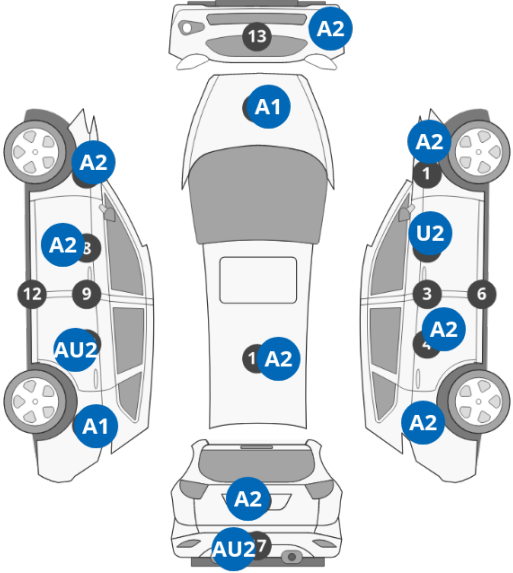
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.6	110	129	135
2	Boot Lid	137.0	143	132	136
3	Roof	158.5	144	153	165/172
4	Left Front Fender	202.0	219	209	178
5	Left Front Door	640.0	1,166	526	228
6	Center Panel Left				
7	Left Rear Door	182.3	208	176	163
8	Left Back Panel	135.0	141	130	134
9	Right Front Fender	134.0	138	136	128
10	Right Front Door	187.3	203	179	180
11	Center Panel Right				
12	Right Rear Door	168.0	162	164	178
13	Right Back Panel	194.6	187	187	210

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Roof Spoiler, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Wiper - Function - Weak

Inspector Notes
with LTO plate and Sparetire, Jack and Incomplete Tools. no warranty booklet and scratch headlight and tail light. fender liner missing and foglight cover missing. rear wiper function opposite