

General Information

Date & Time: 14, Jul, 2025 10:50

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	56,021
Registration No.	NII7597-1	Chassis No.	PA1B18F39P4203434
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



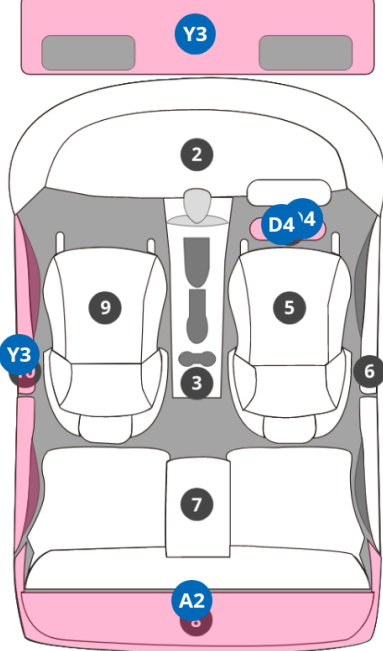
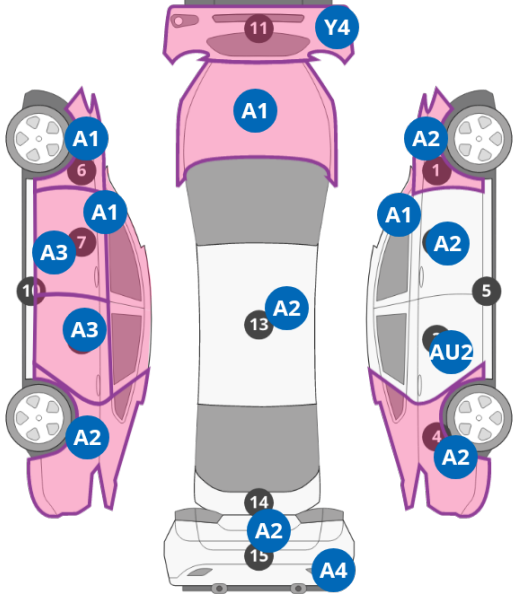
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	214.0	170	209	263
2	Boot Lid	123.6	128	116	127
3	Roof	113.5	128	107	105/114
4	Left Front Fender	111.6	110	110	115
5	Left Front Door	114.3	113	118	112
6	Center Panel Left				
7	Left Rear Door	114.3	117	110	116
8	Left Back Panel	176.6	179	178	173
9	Right Front Fender	192.0	192	191	193
10	Right Front Door	114.0	116	105	121
11	Center Panel Right				
12	Right Rear Door	114.0	112	112	118
13	Right Back Panel	211.3	193	283	158

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Worked - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Large</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, with jack, incomplete tools, with spare tire,</p>