

General Information

Date & Time: 11, Nov, 2024 14:56

Make	Toyota	Model	Hiace
YOM	2023	Mileage	87,576
Registration No.	NIH1348	Chassis No.	JTFNAFAP3N8029090
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



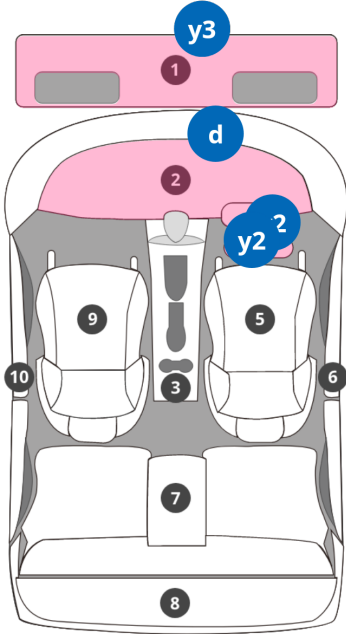
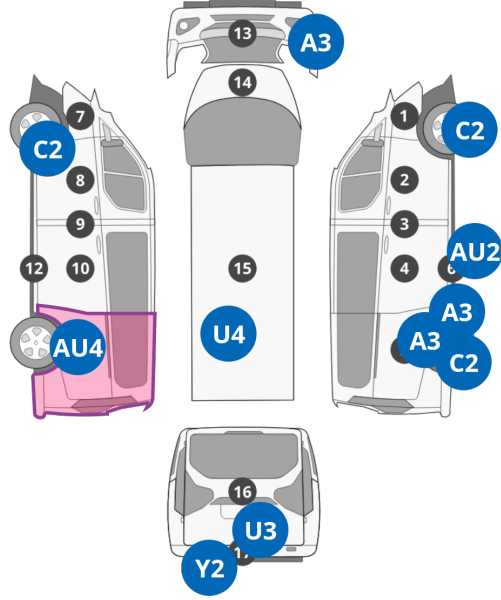
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.8	96	95	97
2	Boot Lid	82.7	80	84	84
3	Roof	97.9	87	83	86/136
4	Left Front Fender	97.2	95	101	96
5	Left Front Door	96.1	103	96	89
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	101.8	93	101	112
9	Right Front Fender	105.0	97	105	113
10	Right Front Door	94.8	91	97	97
11	Center Panel Right	92.1	86	100	90
12	Right Rear Door	93.2	99	95	86
13	Right Back Panel	95.0	91	99	95

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Grime - Small / Ceiling - Grime - Medium / Overall Interior - Worn as per age - Yes	Remarks (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Wheel, Cover - Cap Missing - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Small / Trunk Hood, Rear Gate - Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Dent - Large / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
abnormal engine vibration/ swirl marks and hairline scratches around the exterior/ no warranty booklet/ no jack/ with incomplete tools