

General Information

Date & Time: 14, Jul, 2025 15:51

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	163,356
Registration No.	NCM2834	Chassis No.	JN1TC2E6Z0016185
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Brown		

Body / Panel Condition



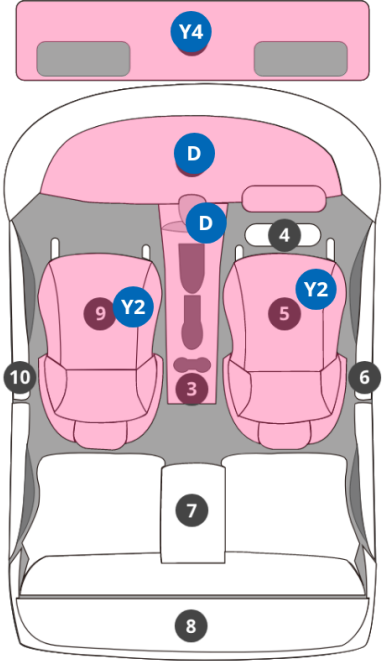
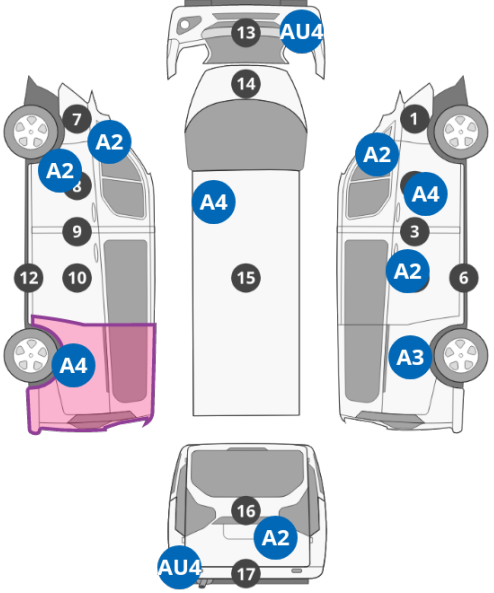
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	217.6	221	227	205
2	Boot Lid	97.4	79	90	123
3	Roof	82.0	73	70	100/85
4	Left Front Fender	132.6	157	111	130
5	Left Front Door	162.0	140	145	201
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	204.6	220	187	207
9	Right Front Fender	152.6	214	109	135
10	Right Front Door	123.0	116	132	121
11	Center Panel Right	161.3	113	188	183
12	Right Rear Door	130.6	125	132	135
13	Right Back Panel	125.0	129	118	128

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / Ceiling - Grime - Large / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Difference in Color / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Door Lock - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>last row rear seat loose. No reverse light. Audio system issue. With warranty booklet and spare tire. Without jack and tools. 1 key. With LTO plate.</p>