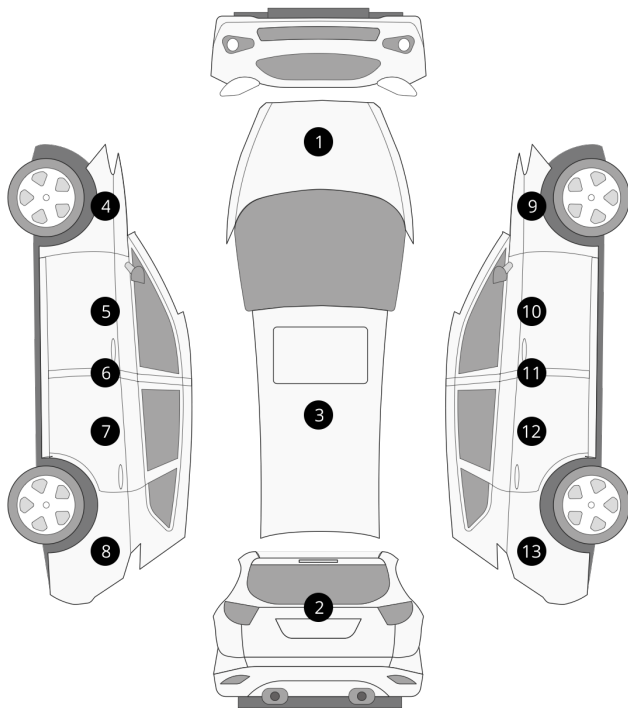


General Information

Date & Time: 18, Jul, 2025 07:50

Make	Toyota	Model	Hilux
YOM	2021	Odo Meter Reading	69,340
Registration No.	NEL1333	Chassis No.	MR0AB8DD8M5032585
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Blue		

Body / Panel Condition



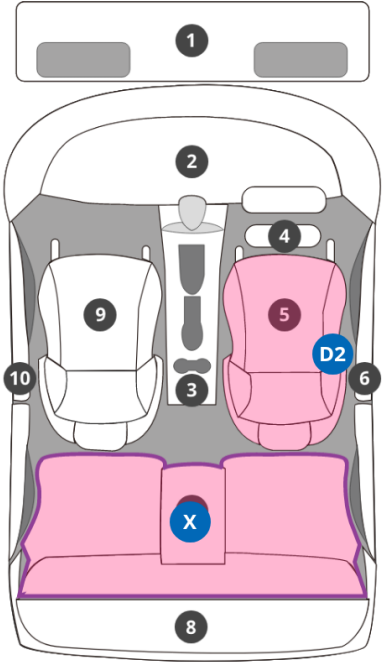
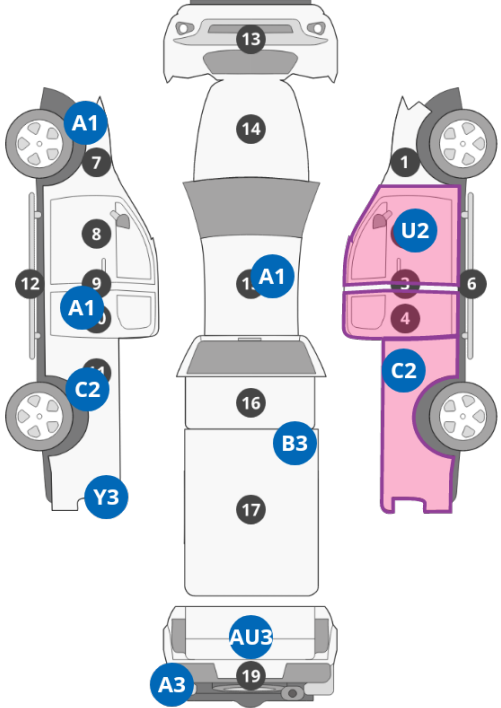
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.3	105	94	102
2	Boot Lid	99.3	108	97	93
3	Roof	103.8	103	98	106/109
4	Left Front Fender	202.0	239	206	161
5	Left Front Door	222.0	203	230	233
6	Center Panel Left	77.0	79	66	86
7	Left Rear Door	157.6	167	159	147
8	Left Back Panel	114.3	114	116	113
9	Right Front Fender	160.3	164	153	164
10	Right Front Door	173.6	162	172	187
11	Center Panel Right	96.8	108	66	117
12	Right Rear Door	174.6	189	164	171
13	Right Back Panel	180.3	174	185	182

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat Head Rest - Missing - Yes / (R) Front Seat belt - Loose, Deformed - Small	Remarks (R) Front Door - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Center Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / (R) Side Gate - Repair mark - Yes / Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Side Gate - Crack, Gap - Medium / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Cargo Bed Floor - Modified - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet, no jack and tools, with spare tire, with LTO plate, front right seat belt partially missing, battery weak