

General Information

Date & Time: 21, Jul, 2025 16:03

Make	Toyota	Model	Lite Ace
YOM	2025	Odo Meter Reading	19,435
Registration No.	DBR6005	Chassis No.	MHKU3FE10RK009688
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



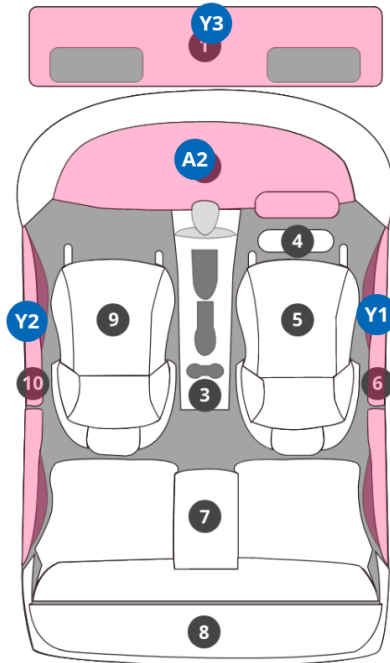
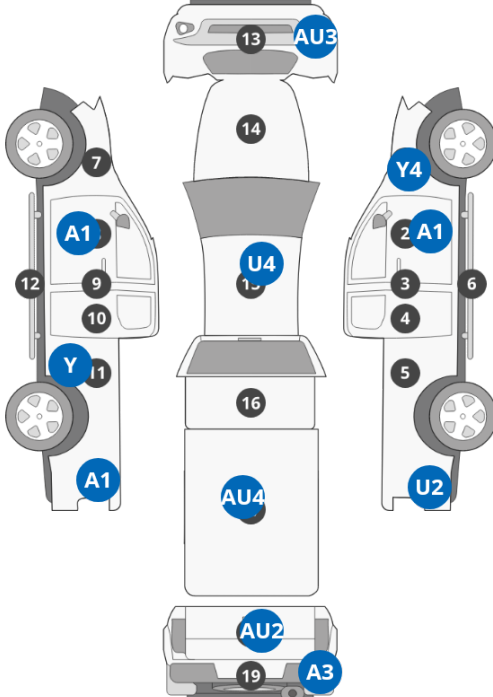
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	66.4	67	69	63
2	Boot Lid	110.6	126	97	109
3	Roof	59.9	47	64	68/61
4	Left Front Fender	58.8	57	58	61
5	Left Front Door	60.7	65	63	55
6	Center Panel Left	67.8	76	61	66
7	Left Rear Door	116.3	113	126	110
8	Left Back Panel	487.6	957	392	114
9	Right Front Fender	65.3	70	62	65
10	Right Front Door	56.7	59	56	55
11	Center Panel Right	67.5	82	55	65
12	Right Rear Door	115.0	121	103	121
13	Right Back Panel	122.3	134	109	124

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small	Remarks (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Side Gate - Dent - Small / Rear Gate - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Wheel, Cover - Cap Crack - Yes / (L) Side Gate - Scratch - Minimal / Cargo Bed Floor - Scratch & Dent - Large / Roof - Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with spare tire/No reverse camera / No warranty booklet/No jack and tools/front right door issue