

General Information

Date & Time: 21, Jul, 2025 10:08

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	121,237
Registration No.	NIH1252	Chassis No.	PA1B18F33N4196882
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



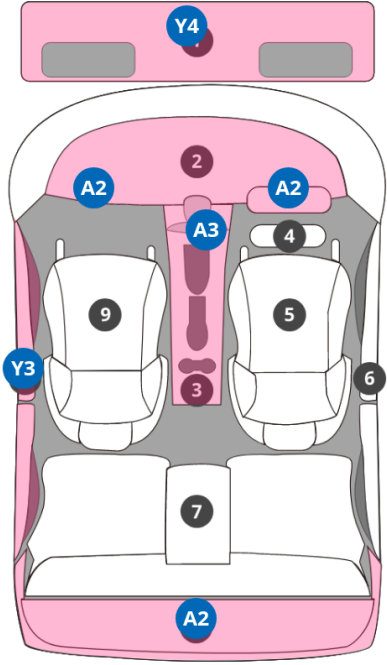
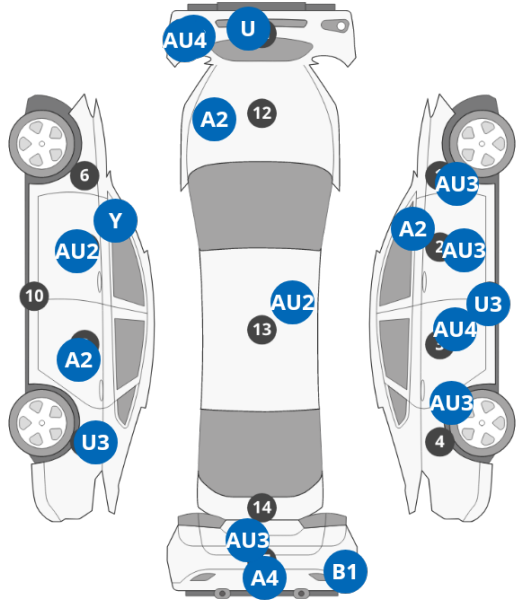
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	175.3	176	176	174
2	Boot Lid	176.0	178	174	176
3	Roof	172.7	175	171	174/171
4	Left Front Fender	180.3	174	187	180
5	Left Front Door	172.6	169	174	175
6	Center Panel Left				
7	Left Rear Door	172.3	173	172	172
8	Left Back Panel	174.0	172	172	178
9	Right Front Fender	172.3	168	175	174
10	Right Front Door	174.0	169	174	179
11	Center Panel Right				
12	Right Rear Door	175.0	177	172	176
13	Right Back Panel	174.0	173	175	174

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Knobs - Worn, Peel, Crack - Medium / Ceiling - Grime - Large / Overall Interior - Worn as per age - Yes / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Overall Exterior - Re-Paint Uneven - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Crack - Damaged / Front Bumper, Grille, Lamps - Modified - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Modified - Minimal
Frame Evaluation : D	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, damaged left side mirror, busted plate light and park light, damaged front grill, damaged headlight , scratches on tail light