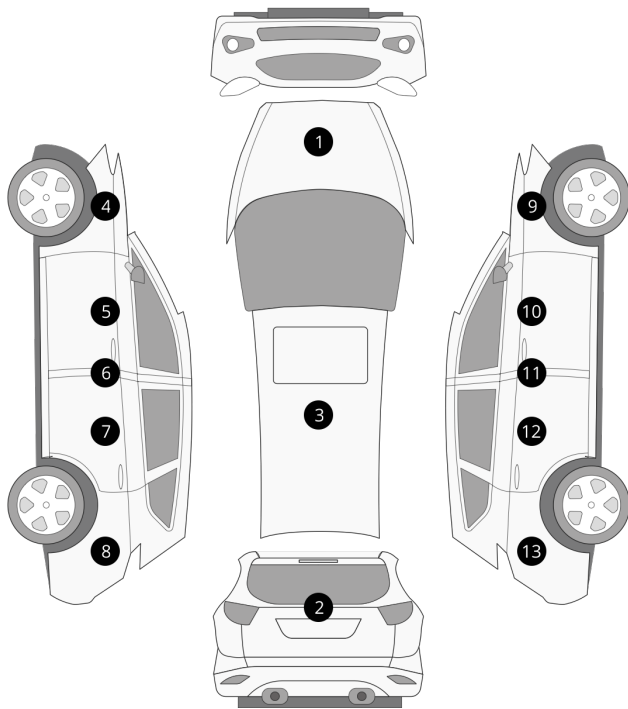


General Information

Date & Time: 21, Jul, 2025 10:06

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	38,909
Registration No.	NFH8620	Chassis No.	PA1B18F38N4177793
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



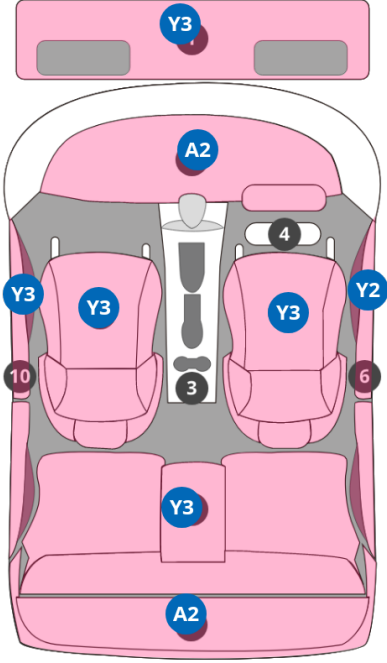
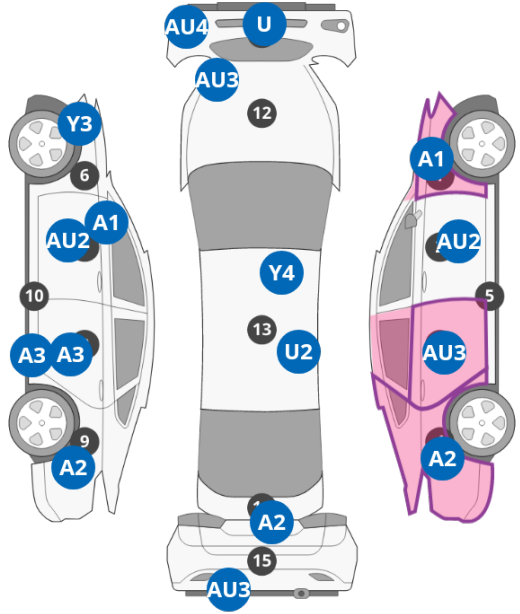
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	102	105	103
2	Boot Lid	99.8	97	101	102
3	Roof	91.3	101	88	89/88
4	Left Front Fender	93.5	96	92	93
5	Left Front Door	101.6	102	104	99
6	Center Panel Left				
7	Left Rear Door	113.0	107	117	115
8	Left Back Panel	101.0	108	99	96
9	Right Front Fender	252.8	90	562	107
10	Right Front Door	133.3	125	154	121
11	Center Panel Right				
12	Right Rear Door	187.3	148	206	208
13	Right Back Panel	173.3	114	118	288

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / Ceiling - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Front Windshield - Damaged - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / (L) Front Fender, Molding - Crack, Gap - Medium / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / Roof - Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : D	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No jack and tools/ No reverse camera/ No warranty booklet/front right side fog light issue/left side headlight missing/signal lights issue