

General Information

Date & Time: 18, Jul, 2025 15:25

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	72,090
Registration No.	NEM5179	Chassis No.	JTFJT02P5M5027992
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



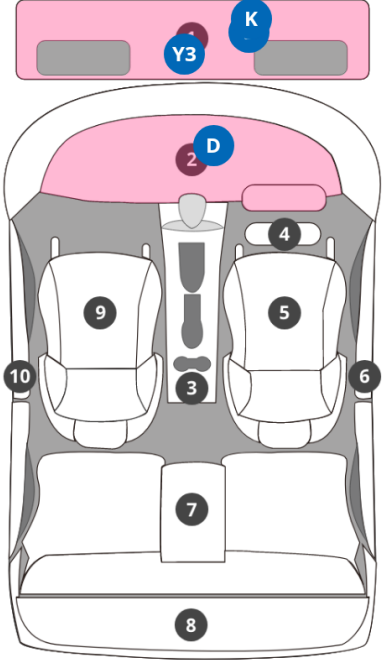
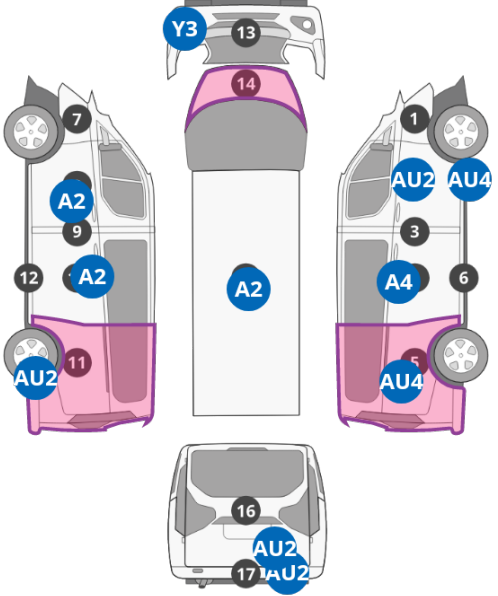
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.6	150	118	118
2	Boot Lid	110.3	108	106	117
3	Roof	114.3	116	98	143/100
4	Left Front Fender	127.6	129	128	126
5	Left Front Door	181.6	291	144	110
6	Center Panel Left	116.6	117	125	108
7	Left Rear Door	121.6	115	132	118
8	Left Back Panel	115.3	110	109	127
9	Right Front Fender	141.6	100	151	174
10	Right Front Door	114.0	113	115	114
11	Center Panel Right	116.0	111	126	111
12	Right Rear Door	115.6	114	120	113
13	Right Back Panel	128.6	127	135	124

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Medium	Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Bonnet, Headlight - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch - Small / (R) Rear Wheel, Cover - Cap Missing - Yes / (L) Rear Wheel, Cover - Cap Missing - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes

With warranty booklet and LTO Plate, Sparetire. no Tools and Jack. missing rear seat, scratch headlight and tail light, scratch side rear glass,missing shift know.