


General Information

Date & Time: 18, Jul, 2025 13:55

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	65,617
Registration No.	DAV9869	Chassis No.	PA1B18F38M4154125
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition

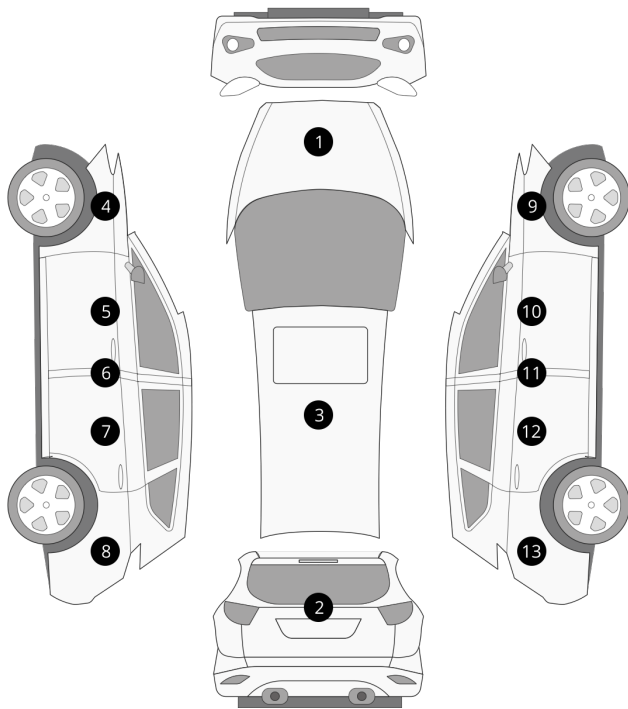

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.3	98	97	106
2	Boot Lid	103.6	100	101	110
3	Roof	101.0	126	85	91/102
4	Left Front Fender	92.9	97	89	94
5	Left Front Door	99.2	97	100	101
6	Center Panel Left				
7	Left Rear Door	93.0	102	90	87
8	Left Back Panel	108.0	114	108	102
9	Right Front Fender	113.3	156	89	95
10	Right Front Door	187.6	193	225	145
11	Center Panel Right				
12	Right Rear Door	203.3	182	190	238
13	Right Back Panel	192.0	176	170	230

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Overall Interior - Worn as per age - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Medium / Rear Seat - Worn - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Dent - Small / (R) Rear Fender, Molding - Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Door Lock - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate but not attached, front side window issue, door luck issue, front side mirror replaced, weak battery, power steering issue due to weak battery, adhesive mark on front windshield