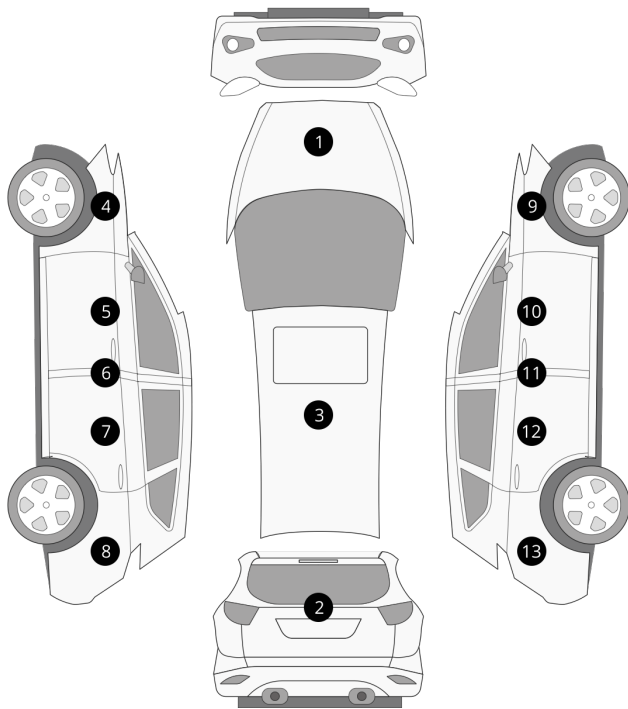


General Information

Date & Time: 21, Jul, 2025 14:02

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	46,264
Registration No.	NEL5051	Chassis No.	MHKA4DF5FMJ057389
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



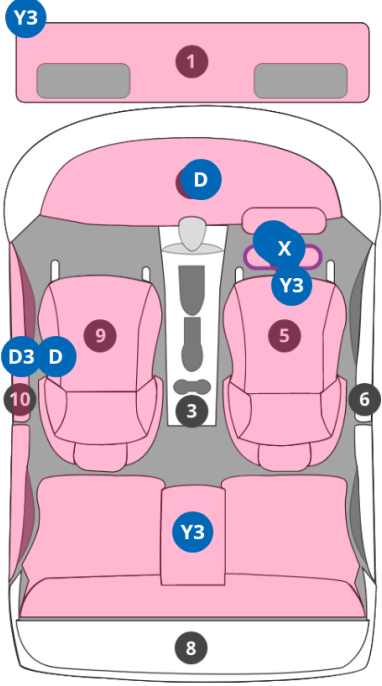
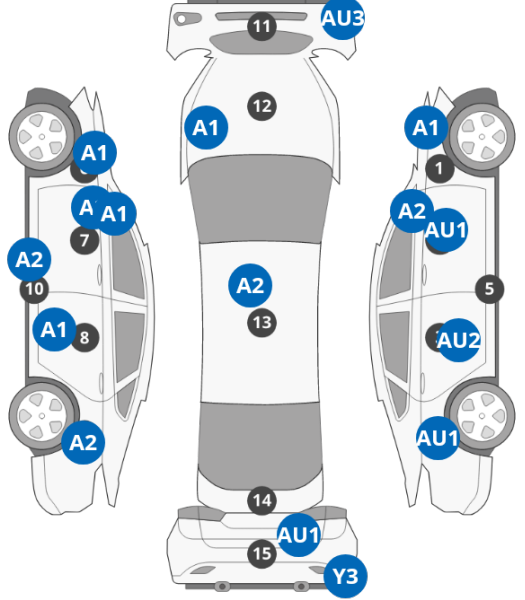
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	177.6	181	209	143
2	Boot Lid	102.9	103	98	108
3	Roof	94.2	85	101	98/93
4	Left Front Fender	251.6	266	235	254
5	Left Front Door	180.6	132	126	284
6	Center Panel Left				
7	Left Rear Door	154.3	157	177	129
8	Left Back Panel	89.3	87	87	94
9	Right Front Fender	246.3	280	237	222
10	Right Front Door	139.0	127	139	151
11	Center Panel Right				
12	Right Rear Door	84.7	88	80	86
13	Right Back Panel	93.5	99	89	93

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (L) Front Trim - Loose, Deformed - Medium / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Shift Shock - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack, no tools, no spare tire, with LTO plate, scratches on tail light, tonneau cover missing, all floormat missing, shifter issue,