

General Information

Date & Time: 21, Jul, 2025 15:40

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	59,651
Registration No.	NEM1829	Chassis No.	PA1B18F39M4144753
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



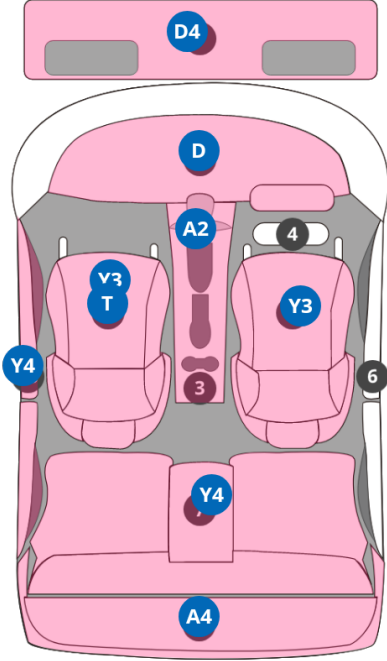
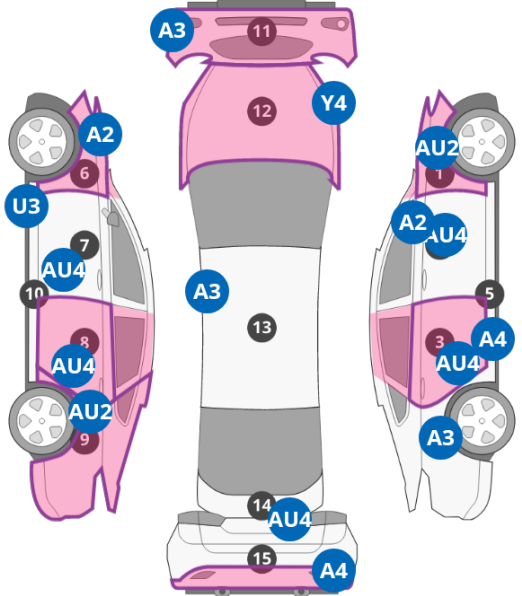
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	182.6	188	184	176
2	Boot Lid	118.3	120	110	125
3	Roof	97.6	102	92	97/100
4	Left Front Fender	195.0	189	183	213
5	Left Front Door	152.3	152	149	156
6	Center Panel Left				
7	Left Rear Door	103.2	108	103	99
8	Left Back Panel	101.3	106	98	100
9	Right Front Fender	192.0	188	196	192
10	Right Front Door	121.3	129	114	121
11	Center Panel Right				
12	Right Rear Door	190.0	198	179	193
13	Right Back Panel	93.2	96	93	91

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Large / Rear Seat - Grime - Large / Ceiling - Crinkle - Large / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Cigarette Burns - Burnt, Hole	Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Dent - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Crack, Gap - Large / Roof - Scratch - Medium
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack, no tools, with spare tire, busted reverse light, busted park light, damaged tail light, tow hook cover missing, scratches on headlight, traces of adhesive on front windshield