

## General Information

Date & Time: 21, Jul, 2025 13:42

<b>Make</b>	Toyota	<b>Model</b>	Fortuner
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	30,064
<b>Registration No.</b>	DBF5902	<b>Chassis No.</b>	MHFCB3GS6P0495044
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	SUV
<b>Colour</b>	Silver		

## Body / Panel Condition



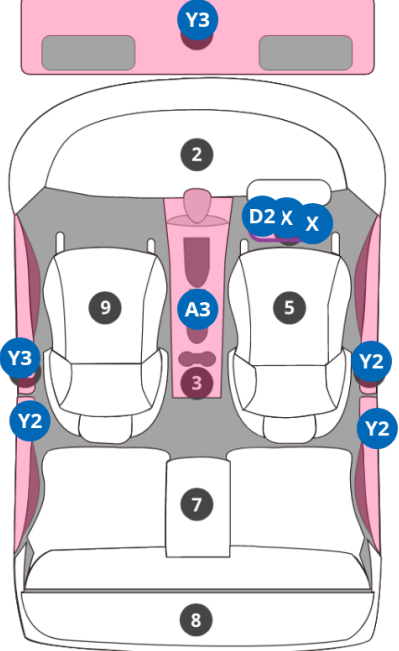
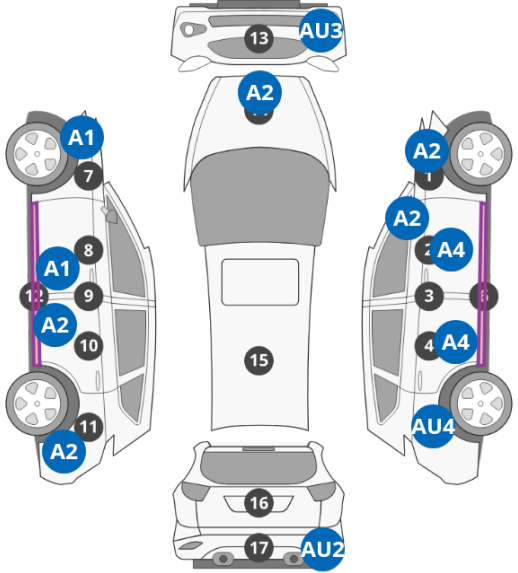
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	115	122	117
2	Boot Lid	100.5	92	115	95
3	Roof	107.7	112	124	97/98
4	Left Front Fender	110.3	102	109	120
5	Left Front Door	111.0	113	112	108
6	Center Panel Left				
7	Left Rear Door	101.8	107	104	95
8	Left Back Panel	112.6	117	109	112
9	Right Front Fender	106.6	107	107	106
10	Right Front Door	110.3	110	114	107
11	Center Panel Right				
12	Right Rear Door	126.6	166	106	108
13	Right Back Panel	111.3	111	106	117

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	C	<b>Exterior Evaluation :</b>	E
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / Knobs - Worn, Peel, Crack - Medium</p>		<p><b>Remarks</b> (L) Step, In-panel, Side Spoiler - Partially Missing - Yes / (R) Step, In-panel, Side Spoiler - Partially Missing - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small</p>	
<b>Frame Evaluation :</b>	A	<b>Functional Evaluation :</b>	B
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

## Inspector Notes

Dead battery. Gap at radio and radio not working. With warranty booklet and seat cover. Without spare tire, jack and tools. 1 key. No LTO plate.