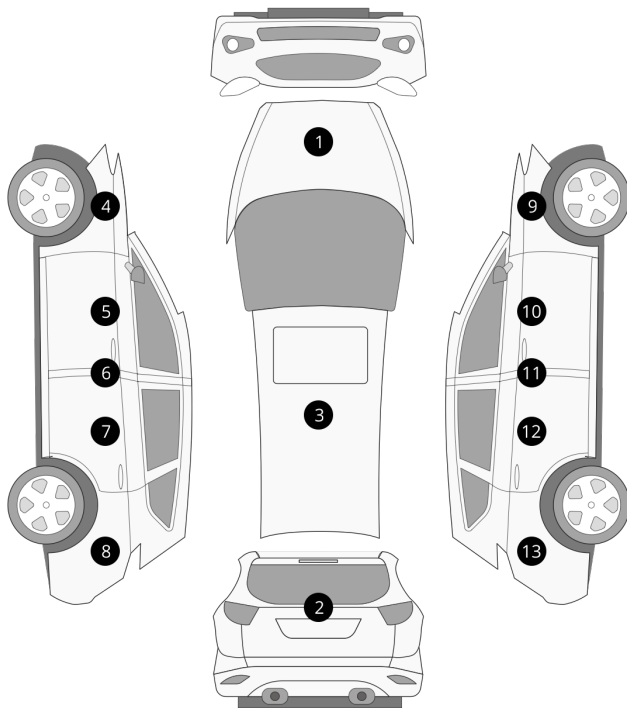


General Information

Date & Time: 23, Jul, 2025 08:52

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	124,062
Registration No.	NIH6820	Chassis No.	PA1B18F36P4209815
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



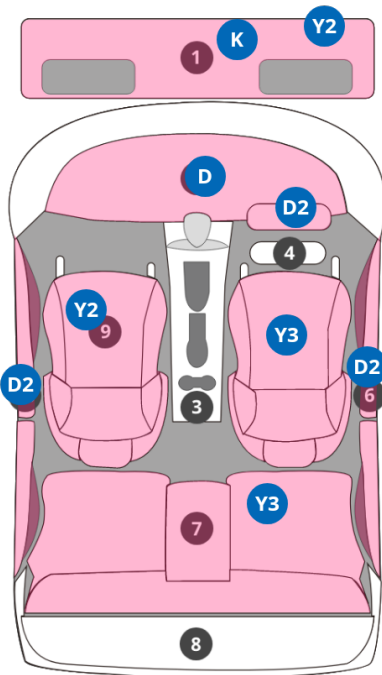
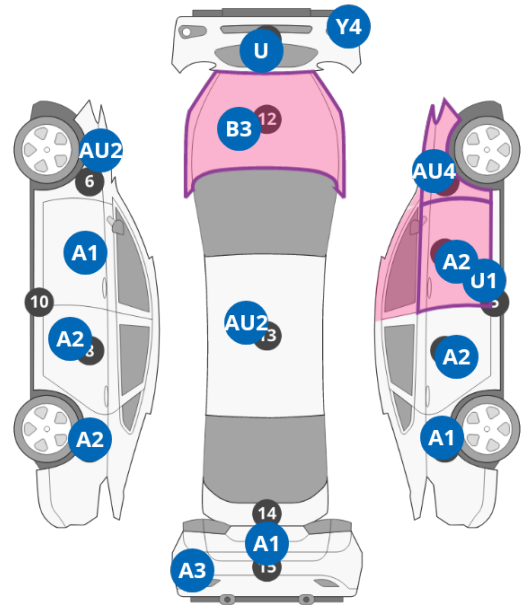
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	111	114	117
2	Boot Lid	108.0	105	105	114
3	Roof	98.6	101	96	98/100
4	Left Front Fender	99.5	100	97	102
5	Left Front Door	99.5	104	98	96
6	Center Panel Left				
7	Left Rear Door	104.0	106	101	105
8	Left Back Panel	106.6	104	108	108
9	Right Front Fender	78.9	81	79	78
10	Right Front Door	240.0	198	363	159
11	Center Panel Right				
12	Right Rear Door	135.6	120	137	150
13	Right Back Panel	153.3	140	146	174

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Ceiling - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / Glove Box - Loose, Deformed - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Member (Bolted) - Dent - Yes / (R) Step, In-panel, Side Spoiler - Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Modified - Medium / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, Incomplete Tools and Spare tire. no Jack, scratch headlight and tail light. Crack right headlight, adhesive marks. plate light busted. glove box not closing properly. tow hook cover missing.