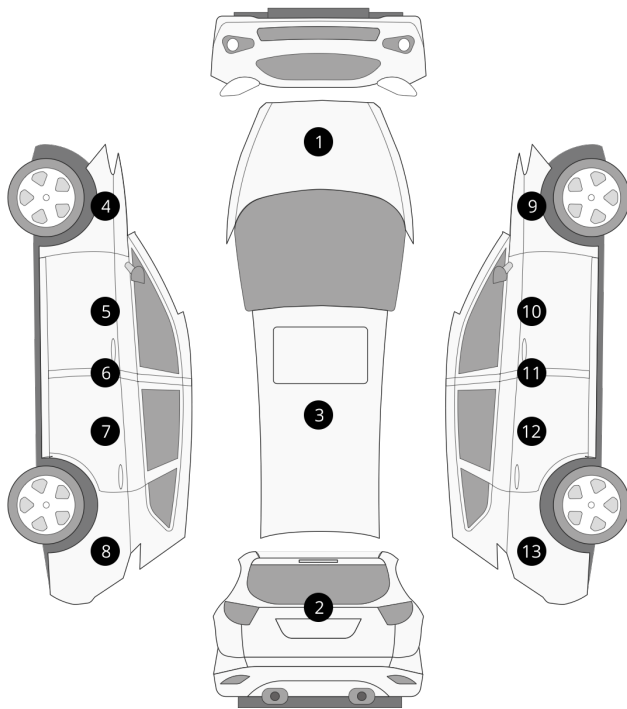


General Information

Date & Time: 30, Jul, 2025 18:53

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	5,563
Registration No.	NKD6467	Chassis No.	PA1B18F38R4257973
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



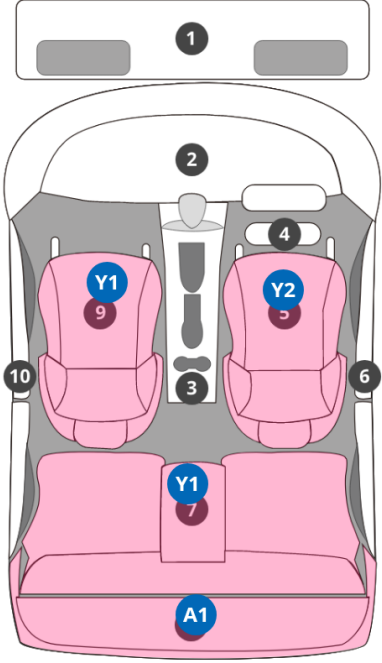
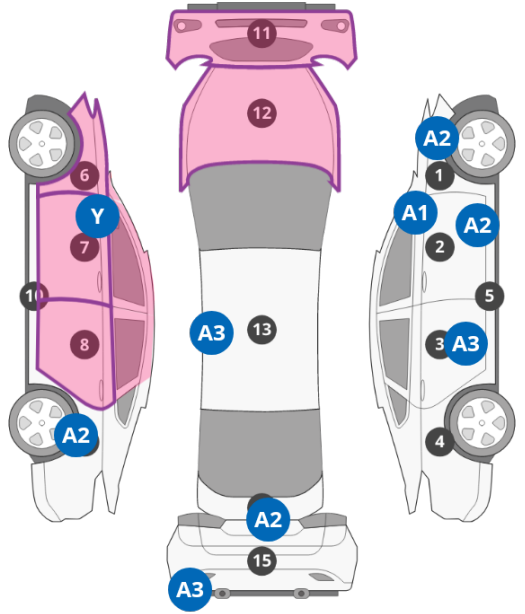
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	191.6	229	135	211
2	Boot Lid	117.6	125	117	111
3	Roof	103.7	106	105	101/103
4	Left Front Fender	183.6	200	167	184
5	Left Front Door	175.3	179	177	170
6	Center Panel Left				
7	Left Rear Door	185.6	184	189	184
8	Left Back Panel	109.0	120	102	105
9	Right Front Fender	99.1	103	93	101
10	Right Front Door	105.3	107	98	111
11	Center Panel Right				
12	Right Rear Door	102.7	96	100	112
13	Right Back Panel	117.6	142	104	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Minimal	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Front Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Crack - Damaged / Roof - Scratch - Medium / Overall Exterior - Re-Paint Uneven - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, damaged side mirror, cowl vent cover missing