

General Information

Date & Time: 21, Jul, 2025 16:16

Make	Honda	Model	HR-V
YOM	2021	Odo Meter Reading	59,247
Registration No.	JAL5295	Chassis No.	MRHU5890MP020120
CC	1.8	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Orange		

Body / Panel Condition



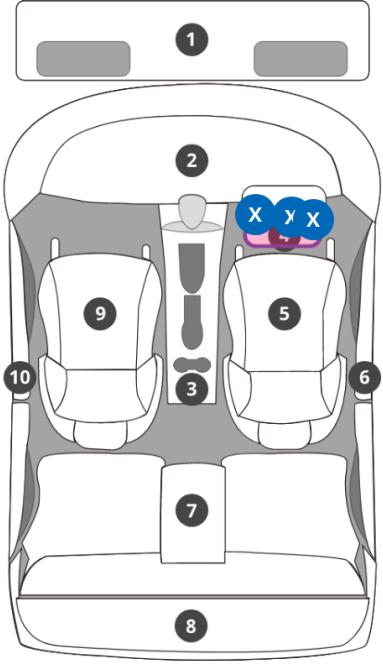
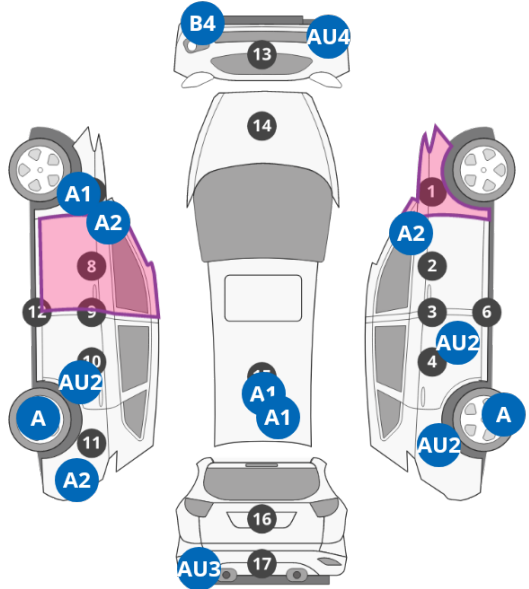
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	105	121	113
2	Boot Lid	110.3	108	118	105
3	Roof	107.7	108	99	110/114
4	Left Front Fender	112.3	104	117	116
5	Left Front Door	116.6	123	114	113
6	Center Panel Left				
7	Left Rear Door	116.3	123	105	121
8	Left Back Panel	122.3	123	124	120
9	Right Front Fender	180.0	174	159	207
10	Right Front Door	168.3	165	158	182
11	Center Panel Right				
12	Right Rear Door	158.6	149	148	179
13	Right Back Panel	123.0	119	120	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Tyre - Crack, Cut - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Modified - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Roof Spoiler, Molding - Scratch - Minimal / (L) Rear Tyre - Crack, Cut - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with lto plate, 1 key, with spare tire, no warranty booklet, no jack and tools, right front bumper repaired,