

## General Information

Date & Time: 21, Jul, 2025 15:52

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	65,219
<b>Registration No.</b>	NES9484	<b>Chassis No.</b>	PA1B18F3XM4164008
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blackish Red Mica		

## Body / Panel Condition



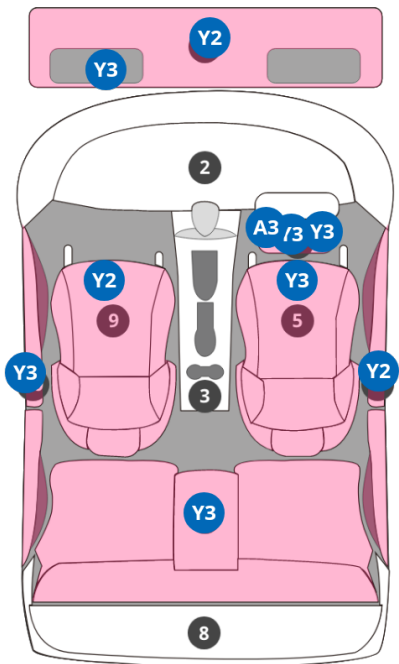
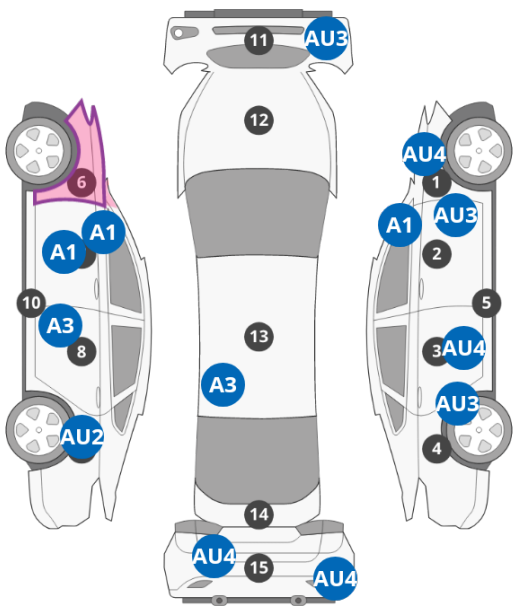
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	165.6	157	177	163
2	Boot Lid	111.6	105	112	118
3	Roof	102.3	109	106	99/95
4	Left Front Fender	169.3	181	178	149
5	Left Front Door	122.0	143	116	107
6	Center Panel Left				
7	Left Rear Door	110.0	109	110	111
8	Left Back Panel	184.0	170	206	176
9	Right Front Fender	121.3	118	125	121
10	Right Front Door	93.2	91	100	89
11	Center Panel Right				
12	Right Rear Door	126.6	135	119	126
13	Right Back Panel	106.0	105	101	112

Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Sunvisor, Sunglass Holder - Grime - Medium / Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / Mat Other - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Fender - Repair Traces - Yes / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / (R) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / Roof - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Reverse light issue. With warranty booklet, spare tire, jack, tools and spare tire. 1 key. With LTO plate.</p>