

## General Information

Date & Time: 25, Jul, 2025 08:30

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2017	<b>Odo Meter Reading</b>	111,978
<b>Registration No.</b>	AOA311	<b>Chassis No.</b>	PA2AA3EM9H0026025
<b>CC</b>	2.8	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	White		

## Body / Panel Condition



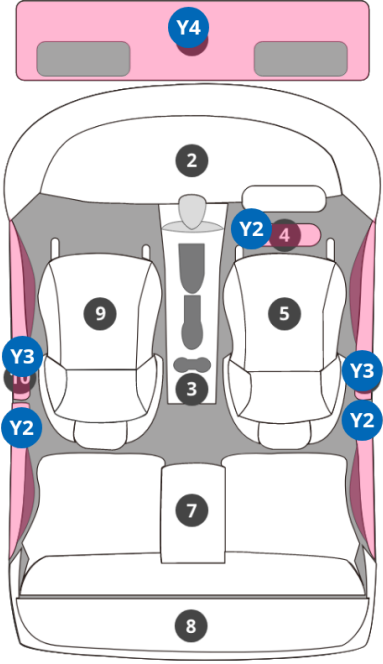
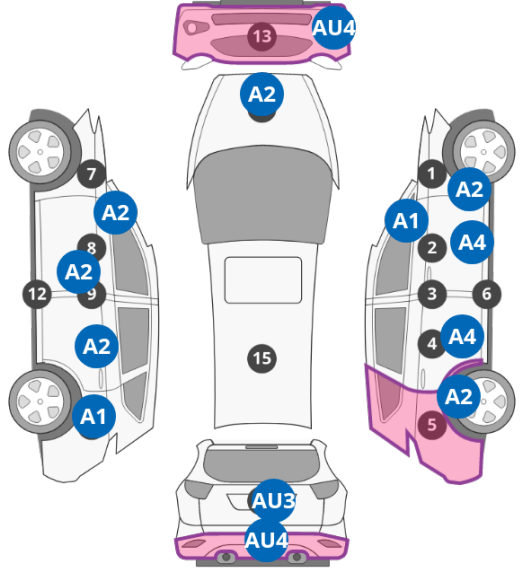
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	259.6	273	248	258
2	Boot Lid	142.3	137	140	150
3	Roof	122.5	126	138	106/120
4	Left Front Fender	210.0	211	222	197
5	Left Front Door	219.0	226	203	228
6	Center Panel Left				
7	Left Rear Door	123.0	127	125	117
8	Left Back Panel	129.6	127	129	133
9	Right Front Fender	132.3	122	142	133
10	Right Front Door	125.3	122	126	128
11	Center Panel Right				
12	Right Rear Door	121.0	112	120	131
13	Right Back Panel	146.6	172	127	141

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Large / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>Double Registration unit . No plate number at OR/CR. Crack left headlight and signal light. Gap at front bumper. Sunvisor light right side issue. Front Ambient light issue. Hard starting. With warranty booklet,sparetire,jack,tools and seat cover. 1 key. No LTO plate.</p>