

General Information

Date & Time: 24, Jul, 2025 15:48

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	42,907
Registration No.	NES1777	Chassis No.	PA1B18F3M4163627
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



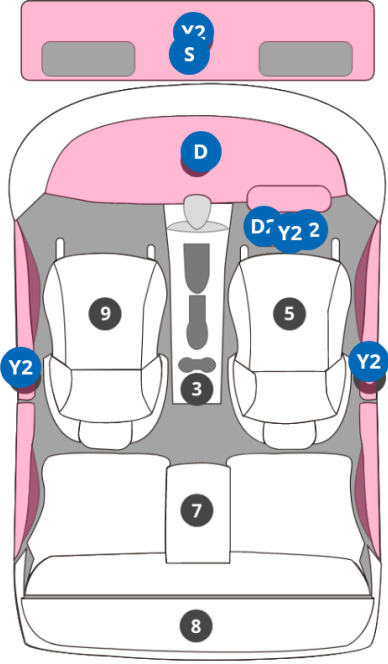
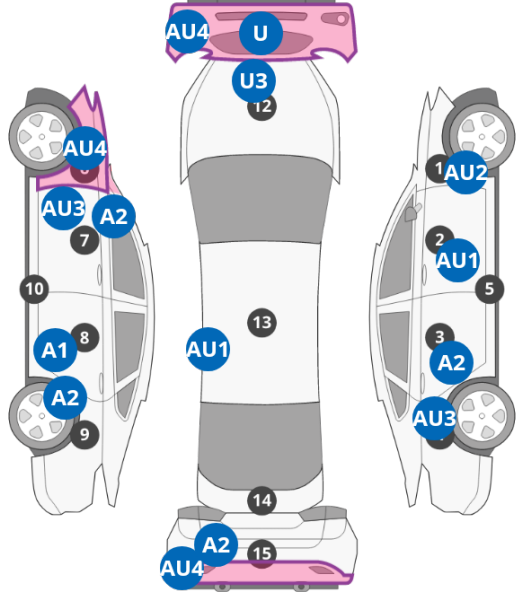
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	108	101	105
2	Boot Lid	165.3	127	124	245
3	Roof	88.8	89	86	85/95
4	Left Front Fender	184.0	187	188	177
5	Left Front Door	130.6	168	109	115
6	Center Panel Left				
7	Left Rear Door	124.3	125	123	125
8	Left Back Panel	97.8	100	96	98
9	Right Front Fender	96.2	100	97	92
10	Right Front Door	96.4	94	96	99
11	Center Panel Right				
12	Right Rear Door	139.0	150	137	130
13	Right Back Panel	168.0	164	159	181

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Mat Other - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Medium / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Gap at front bumper and hood/bonnet. Without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. with LTO plate.</p>