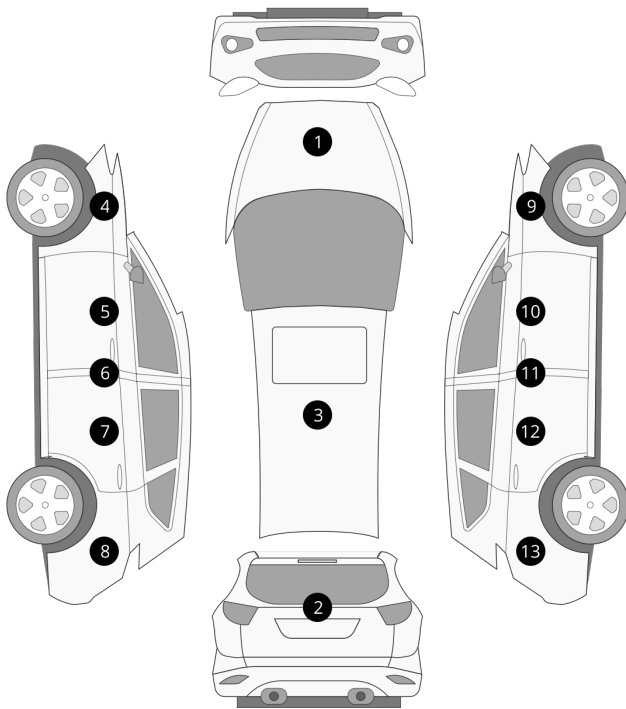


General Information

Date & Time: 01, Aug, 2025 13:03

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	56,480
Registration No.	DAD4295	Chassis No.	PA1B13F35J4055678
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



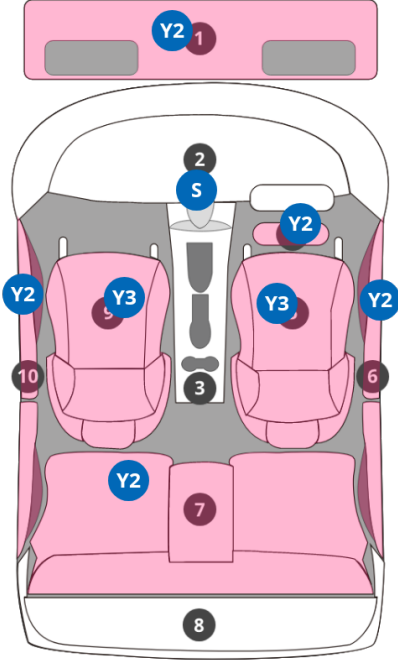
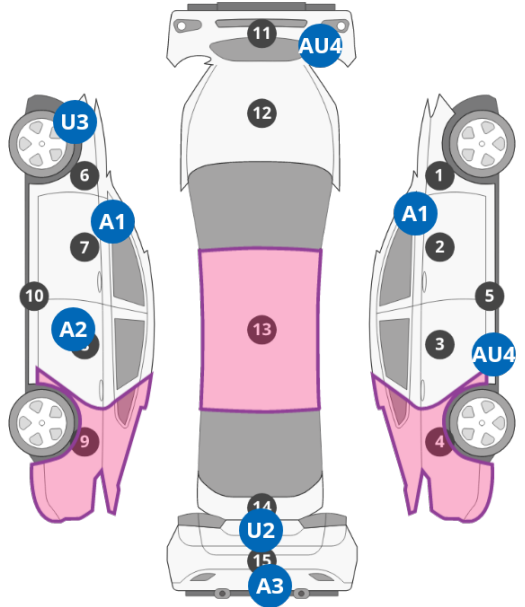
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	126	118	122
2	Boot Lid	119.0	117	113	127
3	Roof	171.6	118	100	100/369
4	Left Front Fender	109.3	112	109	107
5	Left Front Door	109.3	104	117	107
6	Center Panel Left				
7	Left Rear Door	113.0	122	115	102
8	Left Back Panel	183.3	200	184	166
9	Right Front Fender	99.7	107	92	100
10	Right Front Door	109.6	108	115	106
11	Center Panel Right				
12	Right Rear Door	110.0	101	114	115
13	Right Back Panel	427.0	941	165	175

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / (L) Front Fender, Molding - Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (R) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and incomplete tools/ plate light issue/fog light issue/No reverse camera/ with warranty booklet/driver side seat belts issue/ heads unit screen scratches