

## General Information

Date & Time: 30, Jul, 2025 08:26

<b>Make</b>	Toyota	<b>Model</b>	Hiace
<b>YOM</b>	2017	<b>Odo Meter Reading</b>	83,563
<b>Registration No.</b>	DAI2064	<b>Chassis No.</b>	JTFST23P8G0029879
<b>CC</b>	3.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	White		

## Body / Panel Condition



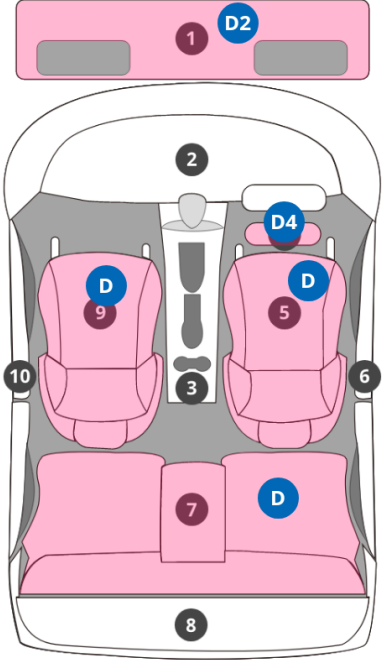
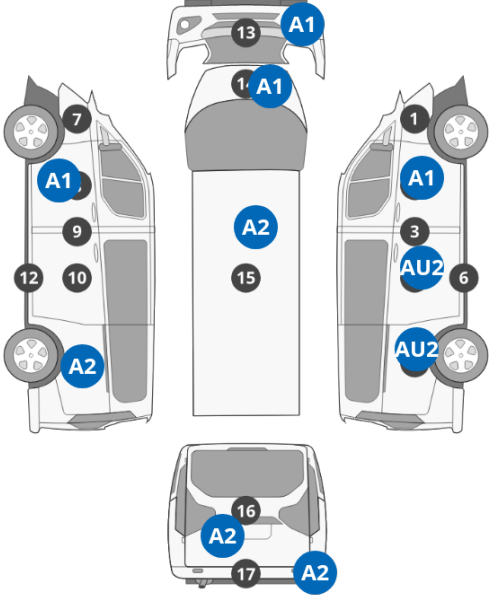
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>136.0</b>	127	150	131
2	Boot Lid	<b>126.6</b>	130	123	127
3	Roof	<b>126.5</b>	135	127	123/121
4	Left Front Fender	<b>124.6</b>	127	113	134
5	Left Front Door	<b>142.0</b>	128	130	168
6	Center Panel Left	<b>143.3</b>	134	138	158
7	Left Rear Door	<b>116.0</b>	118	119	111
8	Left Back Panel	<b>118.3</b>	123	115	117
9	Right Front Fender	<b>124.0</b>	114	113	145
10	Right Front Door	<b>111.6</b>	114	114	107
11	Center Panel Right	<b>128.3</b>	147	122	116
12	Right Rear Door	<b>123.6</b>	125	121	125
13	Right Back Panel	<b>131.6</b>	149	122	124

**Overall Evaluation :**

B

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / Ceiling - Crinkle - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / (L) Front Floor Mat - Worked - Large</p>	<p><b>Remarks</b> (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and Sparetire, Incomplete Tools, Jack. no warranty booklet and scratch headlight and tail light. no plate light.</p>