

## General Information

Date & Time: 01, Aug, 2025 10:17

<b>Make</b>	Lexus	<b>Model</b>	ES
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	72,418
<b>Registration No.</b>	DAM6917	<b>Chassis No.</b>	JTHBZ1B13J2001089
<b>CC</b>	3.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



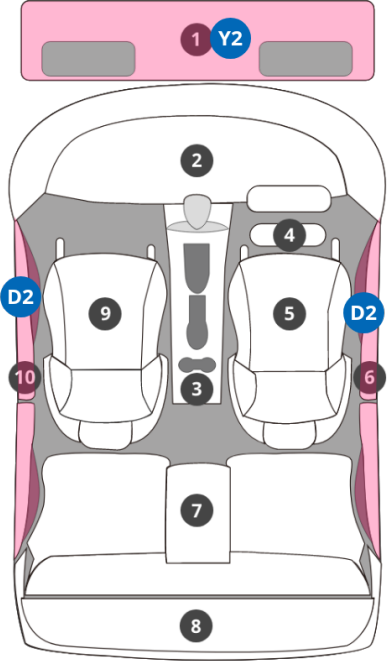
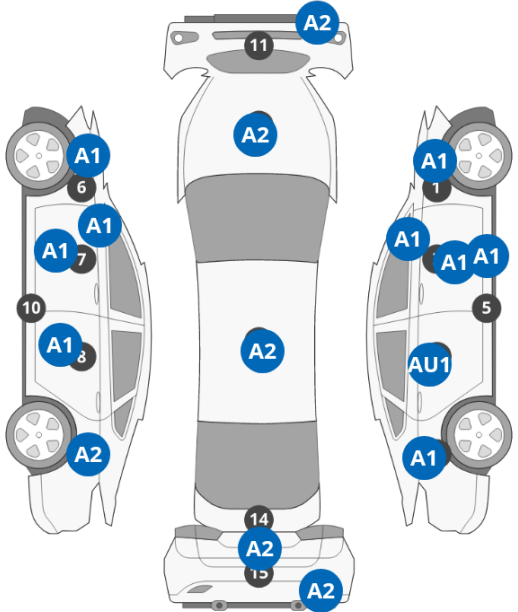
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	89.7	92	87	91
2	Boot Lid	149.6	152	150	147
3	Roof	166.7	173	174	162/158
4	Left Front Fender	99.9	88	106	106
5	Left Front Door	151.6	161	158	136
6	Center Panel Left				
7	Left Rear Door	146.3	147	144	148
8	Left Back Panel	142.6	149	138	141
9	Right Front Fender	99.7	112	102	85
10	Right Front Door	148.3	134	160	151
11	Center Panel Right				
12	Right Rear Door	150.6	151	154	147
13	Right Back Panel	140.0	135	147	138

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small</p>	<p><b>Remarks</b> (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Minimal / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and warranty booklet and Spare tire, Jack and Incomplete Tools. Aircon Blower only lack of freon, adhesive marks on windshield, touch pad hard to work.</p>