

## General Information

Date & Time: 25, Jul, 2025 14:01

<b>Make</b>	Suzuki	<b>Model</b>	Ertiga
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	84,936
<b>Registration No.</b>	NHB6981	<b>Chassis No.</b>	MHYNC22S5PJ107388
<b>CC</b>	1.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	White		

## Body / Panel Condition



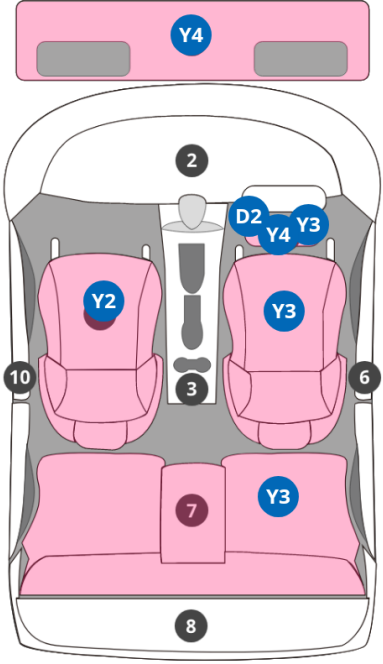
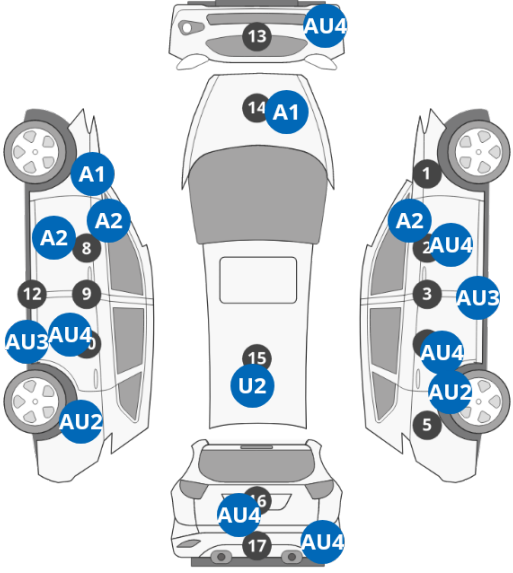
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.3	93	92	101
2	Boot Lid	89.1	86	92	89
3	Roof	86.9	84	88	89/87
4	Left Front Fender	85.5	88	81	88
5	Left Front Door	101.9	109	98	99
6	Center Panel Left				
7	Left Rear Door	102.3	101	101	105
8	Left Back Panel	90.0	91	87	92
9	Right Front Fender	86.6	91	84	85
10	Right Front Door	103.2	106	100	104
11	Center Panel Right				
12	Right Rear Door	106.3	103	102	114
13	Right Back Panel	88.2	92	84	89

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Large / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Grime - Large / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Scratch - Small / Roof - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Right signal light at right front fender loose. Gap at rear bumper. Without warranty booklet and seat cover. with spare tire,jack,and tools. 1 key. With LTO plate.</p>