

General Information

Date & Time: 04, Aug, 2025 12:46

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	25,209
Registration No.	CBI3287	Chassis No.	PA1B18F37P4222709
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



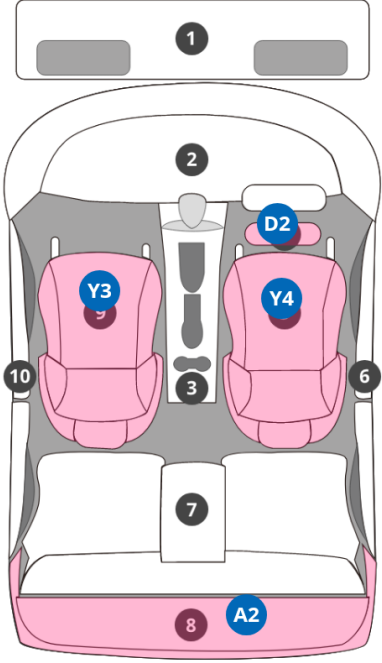
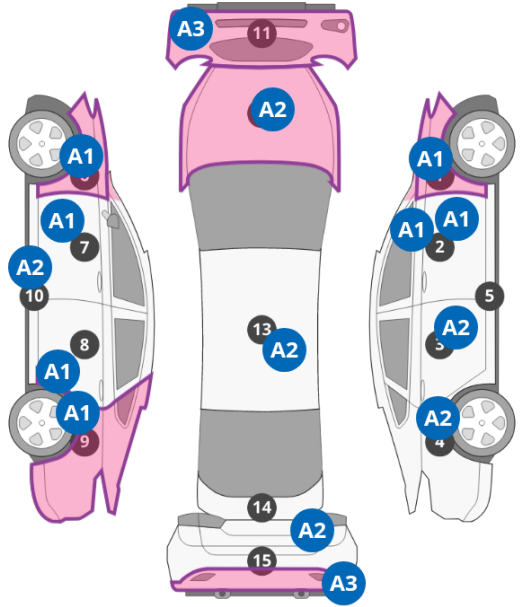
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	196.0	199	193	196
2	Boot Lid	124.6	120	124	130
3	Roof	126.5	118	118	143/127
4	Left Front Fender	114.6	107	117	120
5	Left Front Door	153.6	115	152	194
6	Center Panel Left				
7	Left Rear Door	116.0	123	119	106
8	Left Back Panel	175.6	141	174	212
9	Right Front Fender	136.3	115	151	143
10	Right Front Door	118.3	119	115	121
11	Center Panel Right				
12	Right Rear Door	123.0	113	117	139
13	Right Back Panel	115.0	112	112	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire