

General Information

Date & Time: 16, Nov, 2024 14:58

Make	Toyota	Model	Vios
YOM	2024	Mileage	18,827
Registration No.	NKA3696	Chassis No.	PA1B18F3XR4245971
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



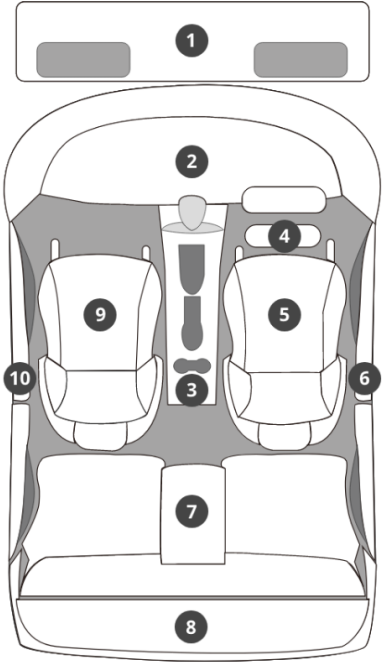
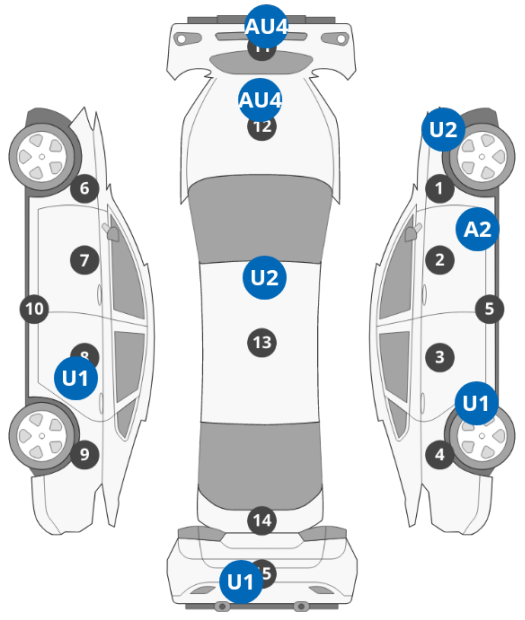
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	156.6	158	151	161
2	Boot Lid	145.6	139	125	173
3	Roof	145.0	164	149	136/131
4	Left Front Fender	148.6	144	135	167
5	Left Front Door	139.6	144	138	137
6	Center Panel Left				
7	Left Rear Door	145.3	147	145	144
8	Left Back Panel	147.0	153	143	145
9	Right Front Fender	147.3	151	144	147
10	Right Front Door	132.3	132	123	142
11	Center Panel Right				
12	Right Rear Door	134.0	125	145	132
13	Right Back Panel	134.3	126	135	142

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks Bonnet, Headlight - Scratch & Dent - Large / (R) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Dent - Minimal / Roof - Dent - Small / (L) Rear Door, Molding - Dent - Minimal
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes

Inspector Notes
incomplete tools/no horn function/front left and right signal lights no function/no warranty booklets/with spare tire and jack