

General Information

Date & Time: 12, Aug, 2025 15:48

Make	Toyota	Model	Hilux
YOM	2019	Odo Meter Reading	123
Registration No.	NGL4173	Chassis No.	MR0CB8CD8K0408965
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



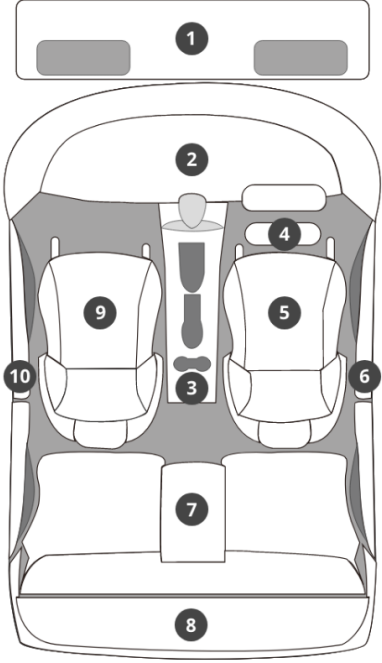
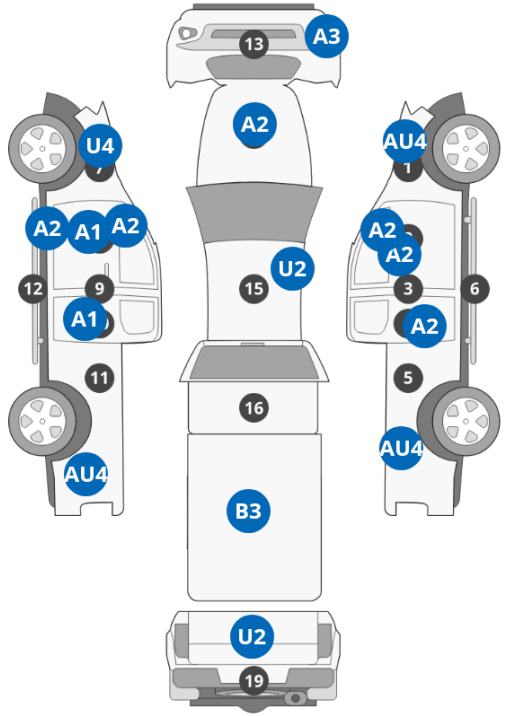
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.3	124	123	126
2	Boot Lid	107.6	111	103	109
3	Roof	117.5	108	131	113/118
4	Left Front Fender	126.6	125	126	129
5	Left Front Door	106.6	114	103	103
6	Center Panel Left	209.6	209	202	218
7	Left Rear Door	222.3	244	237	186
8	Left Back Panel	178.3	167	193	175
9	Right Front Fender	121.3	114	127	123
10	Right Front Door	113.3	114	116	110
11	Center Panel Right	120.6	123	119	120
12	Right Rear Door	114.3	112	108	123
13	Right Back Panel	117.6	121	123	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (L) Center Panel - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (L) Front Fender, Molding - Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Dent - Small / Roof - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Cargo Bed Floor - Modified - Medium / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, no warranty booklet, no jack and tools, with spare tire, no keys, frame, interior, mileage and functional can't be verified due to no keys