

General Information

Date & Time: 28, Jul, 2025 13:57

Make	Suzuki	Model	Ertiga
YOM	2018	Odo Meter Reading	50,841
Registration No.	NBP9274	Chassis No.	MHYZE81S1KJ303160
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



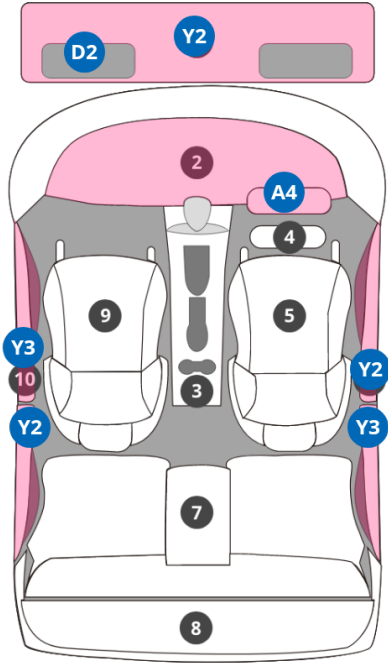
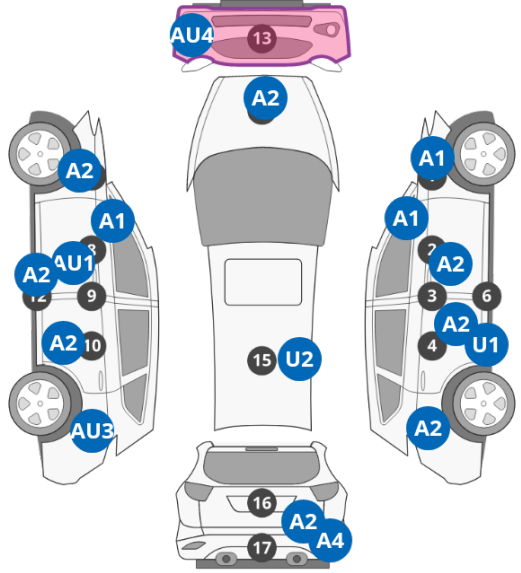
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	77.6	78	75	80
2	Boot Lid	103.8	92	109	111
3	Roof	70.6	74	74	67/68
4	Left Front Fender	224.3	365	165	143
5	Left Front Door	101.3	101	103	100
6	Center Panel Left				
7	Left Rear Door	99.6	99	109	91
8	Left Back Panel	106.1	112	112	94
9	Right Front Fender	84.7	81	89	84
10	Right Front Door	73.6	76	71	74
11	Center Panel Right				
12	Right Rear Door	74.1	71	75	77
13	Right Back Panel	80.2	72	86	83

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Large / Sunvisor, Sunglass Holder - Crinkle - Small / Room Mirror - Partially Missing - Yes</p>		<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small / (R) Step, In-panel, Side Spoiler - Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes

Accelerator pedal cover loose. Rear view mirror partially missing. trunk floor and side cover for tools missing. Without warranty booklet. With Spare tire,jack,tools and leather seat cover. 1 key. With LTO plate.