

## General Information

Date & Time: 28, Jul, 2025 15:21

<b>Make</b>	Ford	<b>Model</b>	Everest
<b>YOM</b>	2017	<b>Odo Meter Reading</b>	8,939
<b>Registration No.</b>	NAE8939	<b>Chassis No.</b>	MNCAXXMAWAGS00029
<b>CC</b>	2.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	White		

## Body / Panel Condition



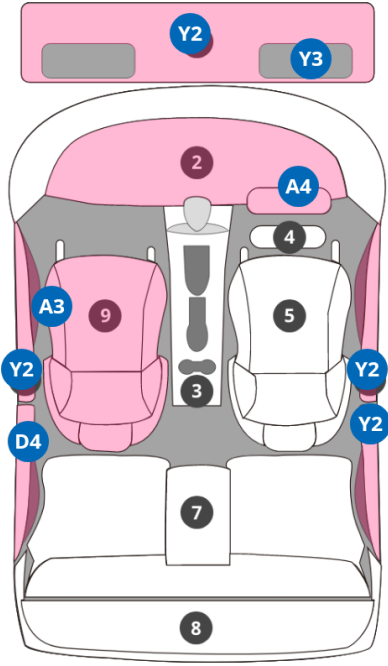
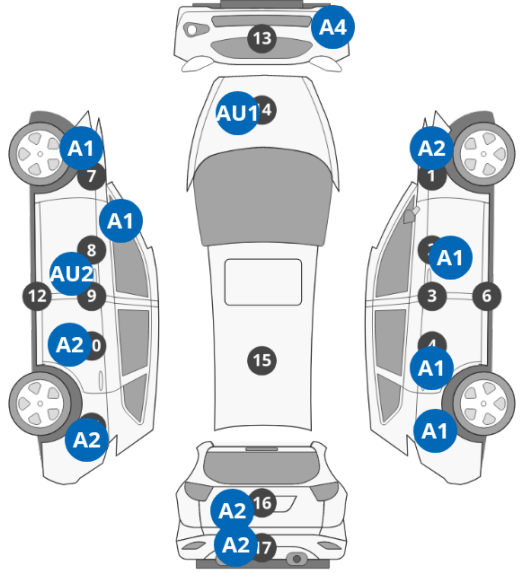
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>91.5</b>	93	92	90
2	Boot Lid	<b>96.4</b>	97	97	95
3	Roof	<b>95.9</b>	96	83	102/102
4	Left Front Fender	<b>94.3</b>	94	92	97
5	Left Front Door	<b>100.6</b>	98	95	109
6	Center Panel Left				
7	Left Rear Door	<b>96.4</b>	101	92	97
8	Left Back Panel	<b>110.0</b>	107	120	103
9	Right Front Fender	<b>158.0</b>	158	166	150
10	Right Front Door	<b>171.6</b>	164	148	203
11	Center Panel Right				
12	Right Rear Door	<b>101.5</b>	98	98	108
13	Right Back Panel	<b>102.3</b>	100	100	107

**Overall Evaluation :**

**B**

**Disclaimer**

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Grime - Medium / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Loose, Deformed - Large / (L) Front Trim - Grime - Small / (L) Front Seat - Cut, Crack - Medium / Steering Wheel - Worn, Peel, Crack - Large</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Possible flooding. Rear right inner door handle missing. With warranty booklet, spare tire and jack. Without tools. 1 key. With LTO plate.</p>