

General Information

Date & Time: 30, Jul, 2025 08:25

Make	Ford	Model	Ranger
YOM	2018	Odo Meter Reading	69,870
Registration No.	NCW2322	Chassis No.	MNCLMFF80JW841716
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Gray		

Body / Panel Condition



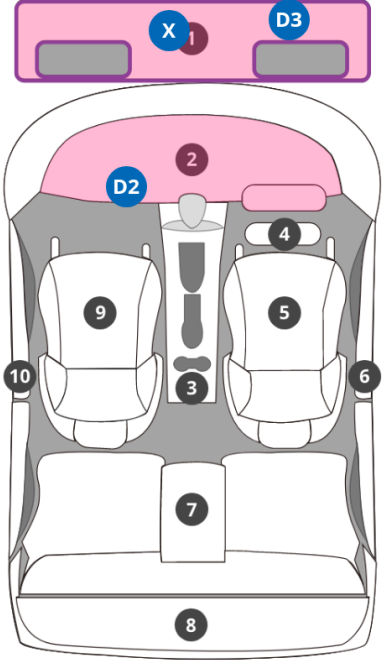
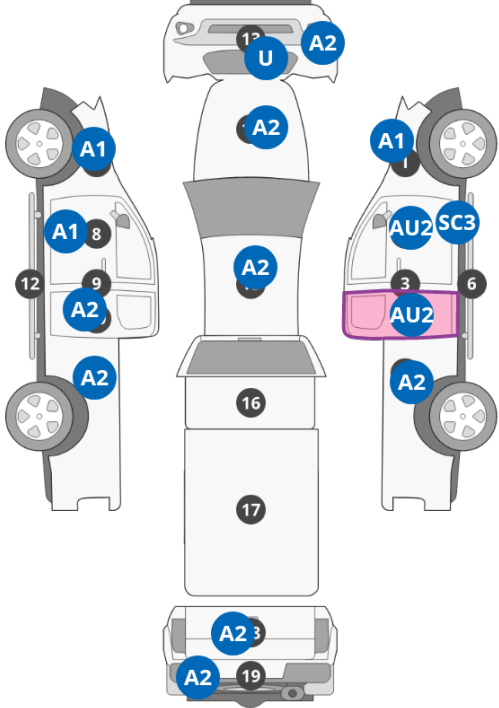
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	140.0	132	150	138
2	Boot Lid	133.3	116	132	152
3	Roof	149.5	135	149	146/168
4	Left Front Fender	138.3	145	141	129
5	Left Front Door	149.0	154	131	162
6	Center Panel Left				
7	Left Rear Door	138.0	152	136	126
8	Left Back Panel	141.0	137	150	136
9	Right Front Fender	148.6	149	142	155
10	Right Front Door	113.8	152	95	94
11	Center Panel Right				
12	Right Rear Door	173.0	176	160	183
13	Right Back Panel	164.0	142	171	179

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Ceiling - Crinkle - Medium / Dashboard - Loose, Deformed - Small / Sunvisor, Sunglass Holder - Missing - Yes</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Rust, Corrosion - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Side Gate - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Side Gate - Scratch - Small / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate, Jack and Sparetire. No warranty booklet and Tools, scratch headlight and tail light, no right signal light and plate light, rear gate didn't open due to the lock in cargo bed, Power window switch don't work in driver side.</p>