

General Information

Date & Time: 30, Jul, 2025 08:41

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	22,423
Registration No.	NEV8259	Chassis No.	PA1B18F3XM4156491
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



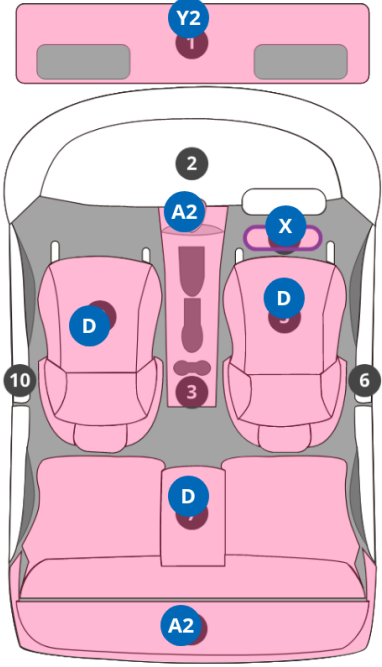
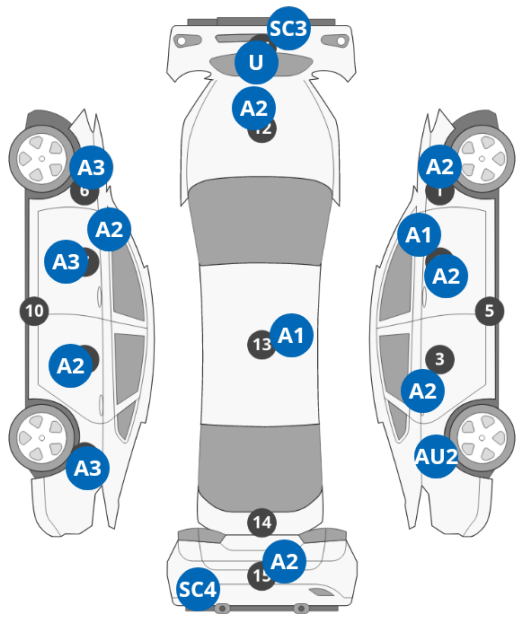
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	236.6	237	239	234
2	Boot Lid	358.6	367	287	422
3	Roof	260.0	253	239	266/282
4	Left Front Fender	238.6	236	238	242
5	Left Front Door	278.0	253	234	347
6	Center Panel Left				
7	Left Rear Door	317.3	402	260	290
8	Left Back Panel	287.3	337	226	299
9	Right Front Fender	237.3	235	239	238
10	Right Front Door	385.0	466	253	436
11	Center Panel Right				
12	Right Rear Door	254.6	249	228	287
13	Right Back Panel	290.0	349	237	284

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Worn - Yes / Ceiling - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Overall Exterior - Re-Paint Uneven - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Rust, Corrosion - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Rust, Corrosion - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no LTO plate, no warranty booklet, no jack and tools, no spare tire, replacement plate, loosed front left door trim, busted headlight, loosed left cheek light, missing trunk floor bed cover, scratches on headlight