

General Information

Date & Time: 29, Jul, 2025 15:43

Make	Suzuki	Model	Ertiga
YOM	2022	Odo Meter Reading	40,840
Registration No.	NFD8710	Chassis No.	MHYNC22SOPJ103524
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Brown		

Body / Panel Condition



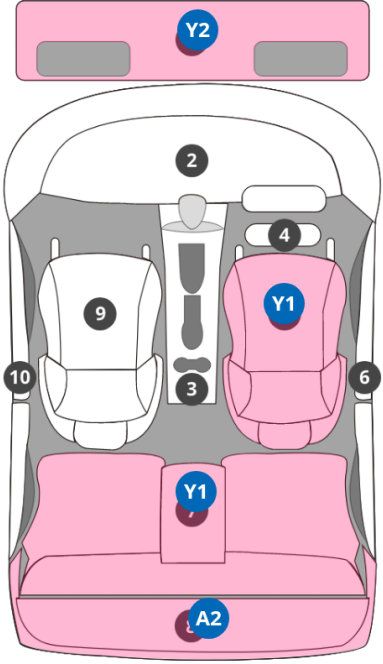
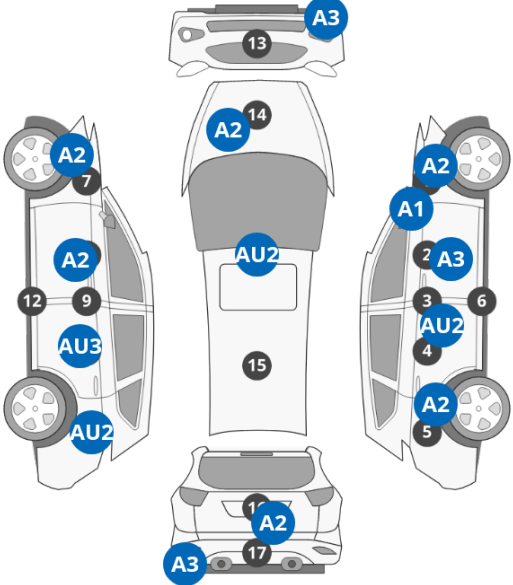
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	133.0	123	154	122
2	Boot Lid	90.3	90	95	86
3	Roof	93.0	94	102	85/91
4	Left Front Fender	97.8	95	89	110
5	Left Front Door	128.6	128	127	131
6	Center Panel Left				
7	Left Rear Door	162.6	176	149	163
8	Left Back Panel	117.4	85	138	129
9	Right Front Fender	153.3	170	147	143
10	Right Front Door	134.0	130	140	132
11	Center Panel Right				
12	Right Rear Door	106.6	103	100	117
13	Right Back Panel	94.8	88	94	103

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / Overall Exterior - Full Re-Paint in same color - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, with jack and incomplete, with spare tire, damaged radio antenna</p>