

## General Information

Date & Time: 04, Aug, 2025 08:40

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2025    | Odo Meter Reading | 8,855             |
| Registration No. | DBP5857 | Chassis No.       | PA1B18F38R4264342 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Black   |                   |                   |

## Body / Panel Condition



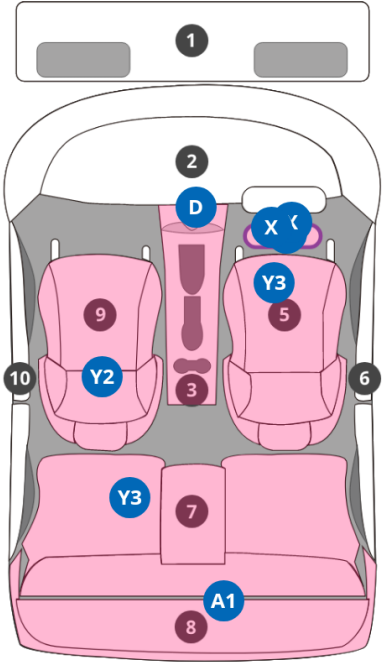
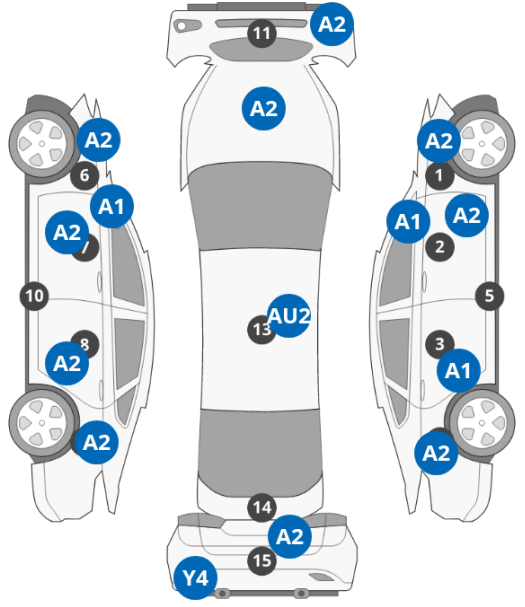
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 120.6         | 135    | 100    | 127      |
| 2  | Boot Lid           | 110.3         | 103    | 109    | 119      |
| 3  | Roof               | 105.7         | 114    | 103    | 103/103  |
| 4  | Left Front Fender  | 101.5         | 98     | 98     | 109      |
| 5  | Left Front Door    | 101.7         | 110    | 98     | 97       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 107.1         | 109    | 97     | 115      |
| 8  | Left Back Panel    | 105.3         | 122    | 101    | 93       |
| 9  | Right Front Fender | 140.6         | 133    | 141    | 148      |
| 10 | Right Front Door   | 115.6         | 122    | 119    | 106      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 121.0         | 123    | 118    | 122      |
| 13 | Right Back Panel   | 117.6         | 108    | 114    | 131      |

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>B</b>                                                                                                                                                                                                                                                                                                       | Exterior Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                   |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                  |
| <b>Remarks</b><br>Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes | <b>Remarks</b><br>(R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                          | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                  | <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |

## Inspector Notes

with LTO plate, no warranty booklet, no jack and tools, with spare tire, loosed right cheek light, scratches on tail light, traces of adhesive on front windshield and side mirrors, rear bumper reflector damaged, battery leak