


General Information

Date & Time: 01, Aug, 2025 15:14

Make	Toyota	Model	Innova
YOM	2022	Odo Meter Reading	35,451
Registration No.	NES8297	Chassis No.	PA2JA8EM4M0099391
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition

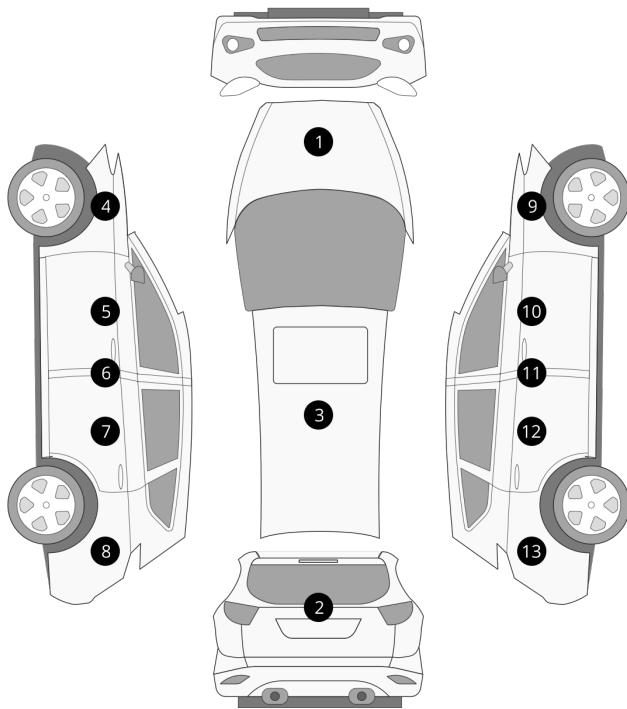

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	137.3	116	172	124
2	Boot Lid	96.7	99	93	99
3	Roof	89.7	90	89	87/93
4	Left Front Fender	121.6	172	100	93
5	Left Front Door	103.1	105	105	99
6	Center Panel Left				
7	Left Rear Door	104.3	104	100	109
8	Left Back Panel	106.0	113	104	101
9	Right Front Fender	99.2	93	102	103
10	Right Front Door	105.0	103	101	111
11	Center Panel Right				
12	Right Rear Door	108.6	106	108	112
13	Right Back Panel	172.3	200	169	148

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Minimal	Remarks (R) Rear Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes

Inspector Notes

Horn issue. USB aux cover missing at radio. scratches on taillights. Without warranty booklet,jack,tools and seat cover. With spare tire. 2 keys. With LTO plate.