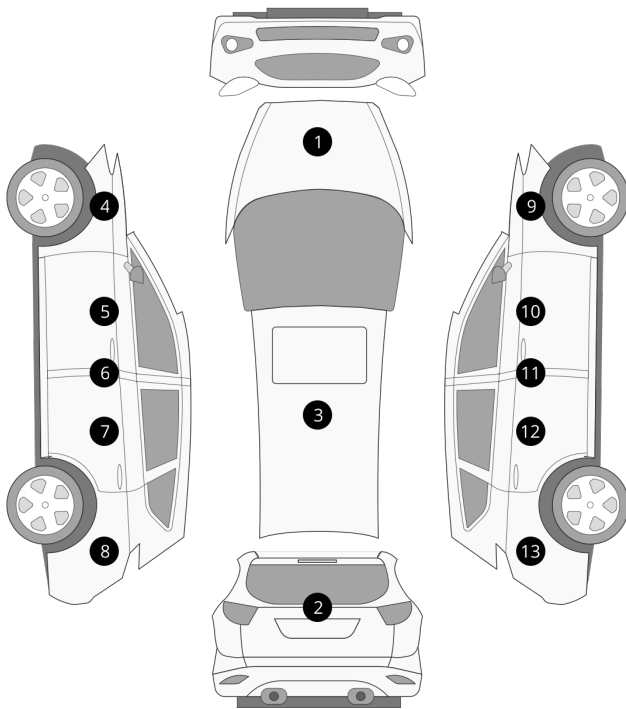


## General Information

Date & Time: 01, Aug, 2025 16:43

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2025    | Odo Meter Reading | 25,054            |
| Registration No. | NKF6675 | Chassis No.       | PA1B18F34R4272275 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Blue    |                   |                   |

## Body / Panel Condition



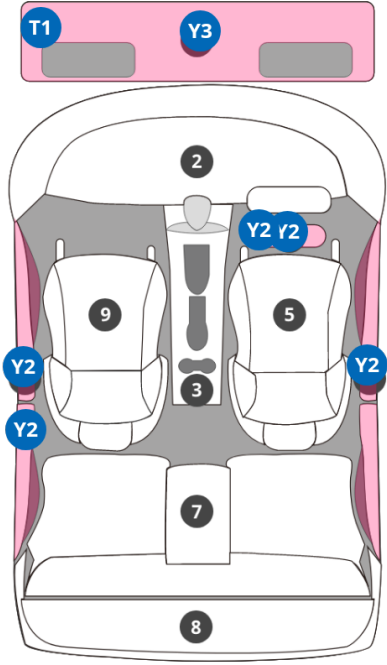
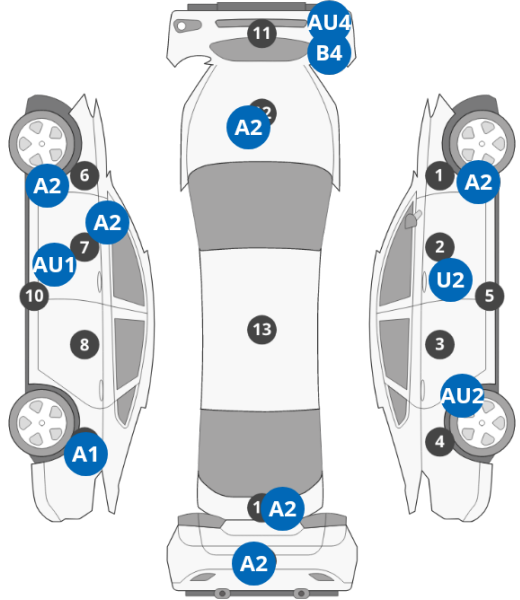
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 106.6         | 103    | 107    | 110      |
| 2  | Boot Lid           | 107.0         | 101    | 110    | 110      |
| 3  | Roof               | 96.2          | 102    | 97     | 91/94    |
| 4  | Left Front Fender  | 93.6          | 96     | 92     | 93       |
| 5  | Left Front Door    | 102.2         | 100    | 100    | 107      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 102.7         | 113    | 100    | 95       |
| 8  | Left Back Panel    | 105.3         | 110    | 103    | 103      |
| 9  | Right Front Fender | 101.0         | 97     | 105    | 101      |
| 10 | Right Front Door   | 98.5          | 98     | 99     | 99       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 97.4          | 96     | 95     | 101      |
| 13 | Right Back Panel   | 107.0         | 107    | 102    | 112      |

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>B</b>                                                                                                                                                                                                                                        | Exterior Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                    |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                   |
| <p><b>Remarks</b></p> <p>Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Cigarette Burns - Burnt Minimal</p> | <p><b>Remarks</b></p> <p>Front Bumper, Grille, Lamps - Modified - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small</p> |
| Frame Evaluation : <b>B</b>                                                                                                                                                                                                                                           | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <p><b>Remarks</b></p> <p>Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>                                                                                                                                                         | <p><b>Remarks</b></p> <p>Defects not found</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |

| Inspector Notes                                                                        |
|----------------------------------------------------------------------------------------|
| With warranty booklet, spare tire, jack, tools and seat cover. 2 keys. With LTO plate. |