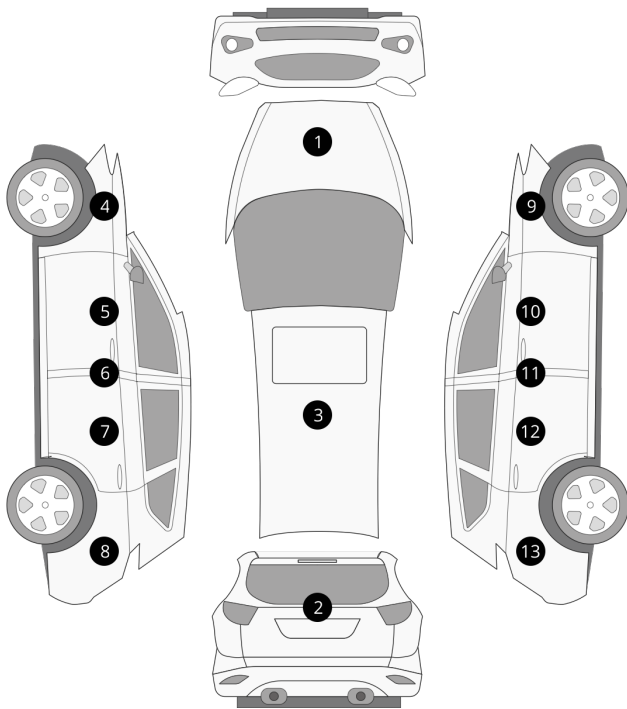


## General Information

Date & Time: 31, Jul, 2025 18:47

|                  |                   |                   |                   |
|------------------|-------------------|-------------------|-------------------|
| Make             | Toyota            | Model             | Vios              |
| YOM              | 2023              | Odo Meter Reading | 125,384           |
| Registration No. | NHC1564           | Chassis No.       | PA1B18F35N4192588 |
| CC               | 1.3               | Transmission      | CVT               |
| Fuel Type        | Gas               | Type of Body      | Sedan             |
| Colour           | Red Mica Metallic |                   |                   |

## Body / Panel Condition



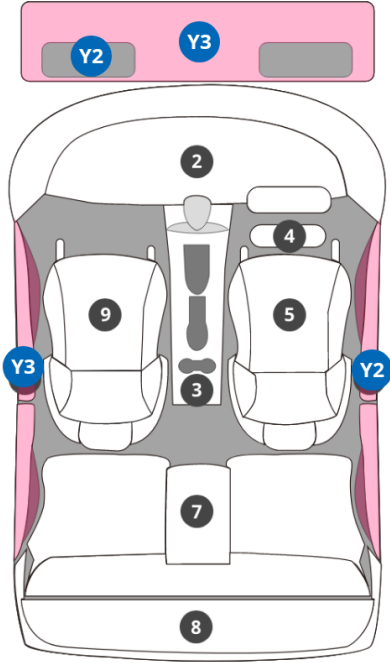
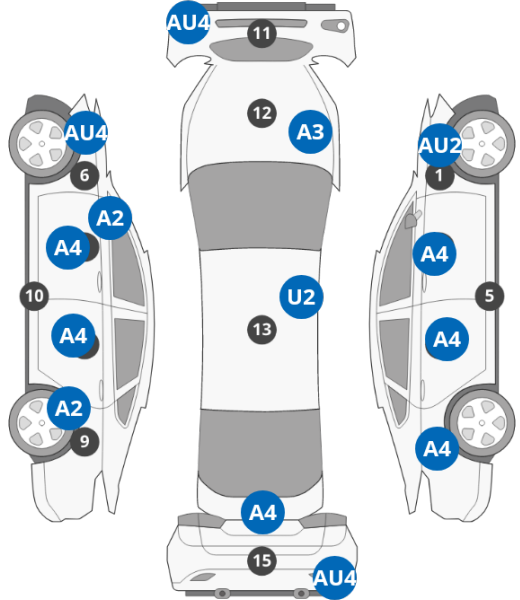
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 102.3         | 106    | 100    | 101      |
| 2  | Boot Lid           | 89.6          | 95     | 83     | 91       |
| 3  | Roof               | 93.5          | 102    | 88     | 93/92    |
| 4  | Left Front Fender  | 100.3         | 103    | 101    | 97       |
| 5  | Left Front Door    | 107.0         | 105    | 112    | 104      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 100.9         | 102    | 101    | 100      |
| 8  | Left Back Panel    | 152.0         | 154    | 139    | 163      |
| 9  | Right Front Fender | 94.2          | 96     | 93     | 94       |
| 10 | Right Front Door   | 93.9          | 98     | 92     | 92       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 95.4          | 90     | 93     | 104      |
| 13 | Right Back Panel   | 145.6         | 139    | 140    | 158      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>B</b>                                                                                                                                                                                                                     | Exterior Evaluation : <b>E</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                      |
| <p><b>Remarks</b><br/>Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small</p>                                                                                  | <p><b>Remarks</b><br/>(R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch - Medium / Roof - Dent - Small</p> |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                        | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <p><b>Remarks</b><br/>Defects not found</p>                                                                                                                                                                                                        | <p><b>Remarks</b><br/>Reverse Camera - N/A - Yes</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |

## Inspector Notes

Original mattings missing. Gap at front and rear bumper. Without warranty booklet. With Spare tire,jack and seat cover. Incomplete tools. 2 keys. With LTO plate,