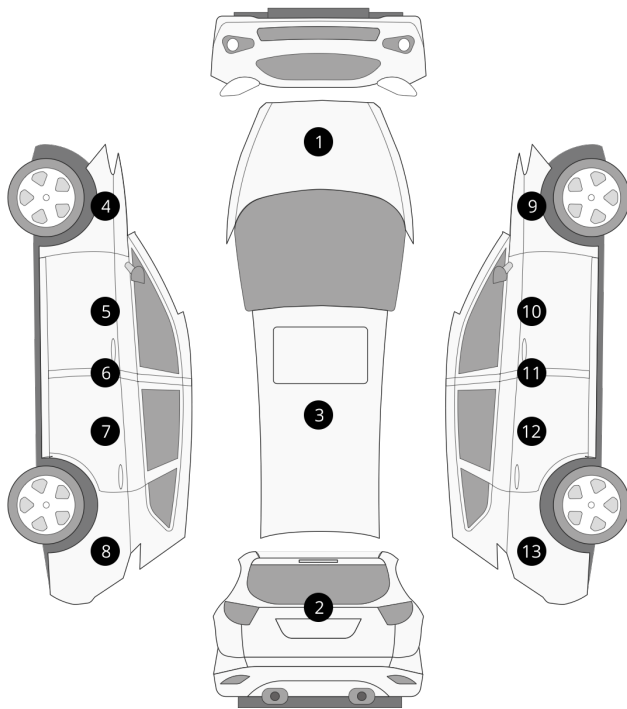


General Information

Date & Time: 01, Aug, 2025 17:04

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	61,550
Registration No.	BAC5273	Chassis No.	PA1B18F31N4178087
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



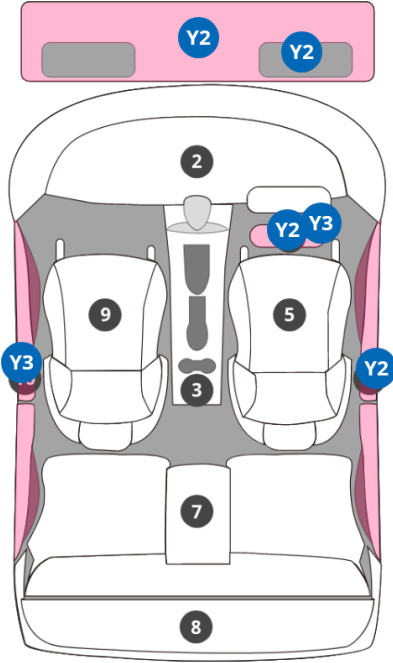
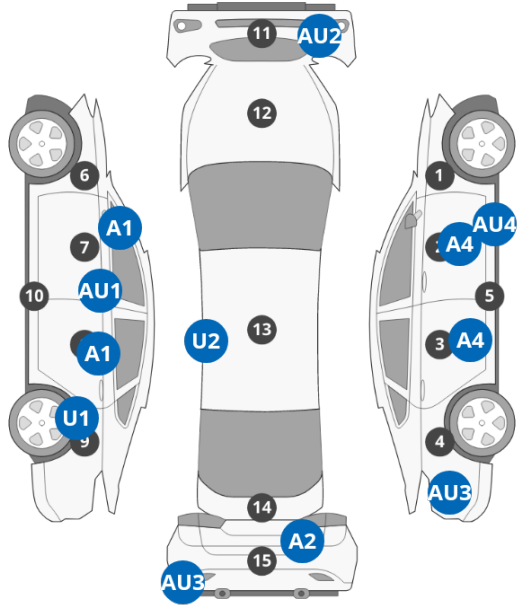
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	85.1	75	98	83
2	Boot Lid	169.0	159	179	169
3	Roof	92.4	106	80	87/96
4	Left Front Fender	121.6	144	106	115
5	Left Front Door	105.4	99	113	104
6	Center Panel Left				
7	Left Rear Door	104.3	103	104	106
8	Left Back Panel	108.3	117	106	102
9	Right Front Fender	93.4	97	91	92
10	Right Front Door	101.4	106	101	97
11	Center Panel Right				
12	Right Rear Door	97.7	89	95	109
13	Right Back Panel	101.6	100	100	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small / (L) Front Trim - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Roof - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Honda mags installed in this unit. Molds at seatbelts. Trunk floor missing. Without warranty booklet, spare tire, jack and tools. With seat cover. 1 key. With LTO plate.