

General Information

Date & Time: 07, Aug, 2025 10:06

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	112,607
Registration No.	NIJ9183	Chassis No.	MHFAA1BY5P0012153
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



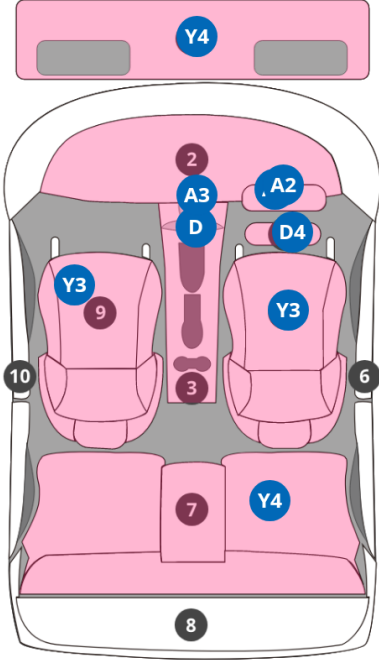
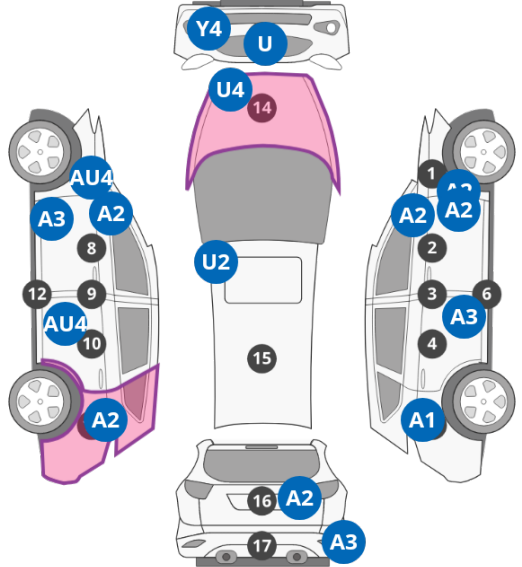
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	184.3	153	176	224
2	Boot Lid	113.6	130	105	106
3	Roof	112.5	129	117	99/105
4	Left Front Fender	138.0	135	162	117
5	Left Front Door	122.0	127	114	125
6	Center Panel Left				
7	Left Rear Door	127.3	127	118	137
8	Left Back Panel	173.3	182	168	170
9	Right Front Fender	109.0	109	109	109
10	Right Front Door	120.3	127	117	117
11	Center Panel Right				
12	Right Rear Door	126.0	132	120	126
13	Right Back Panel	149.3	142	151	155

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / (R) Front Seat - Grime - Medium / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Large / Glove Box - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Large	Remarks Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Dent - Large / Roof - Dent - Small
Frame Evaluation : D	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete, with spare tire, damaged headlight, scratches on tail light, busted headlight, busted tail light, busted plate light, busted foglamps, busted parklight, rear AC not working, front left door issue, towed unit