

General Information

Date & Time: 05, Aug, 2025 18:52

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	25,400
Registration No.	NHF9121	Chassis No.	PA1B18F35P4234101
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



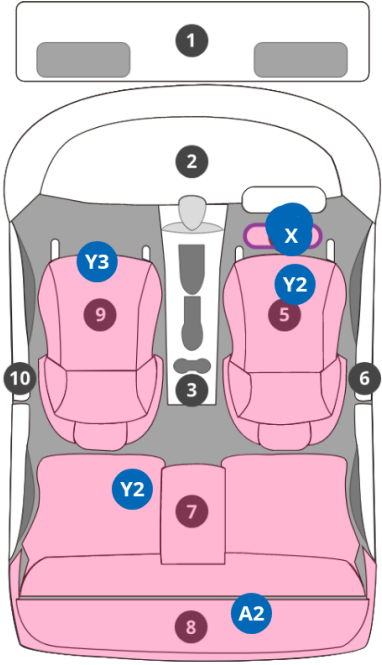
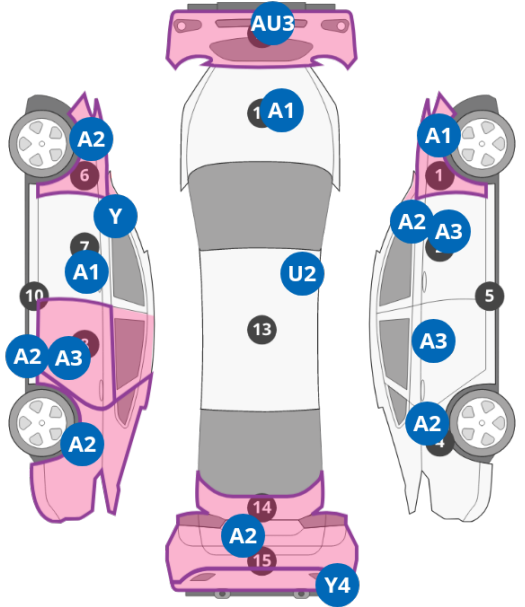
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.2	107	98	108
2	Boot Lid	183.3	171	171	208
3	Roof	98.2	95	98	91/109
4	Left Front Fender	99.0	97	98	102
5	Left Front Door	102.8	108	95	105
6	Center Panel Left				
7	Left Rear Door	143.3	141	148	141
8	Left Back Panel	173.6	181	178	162
9	Right Front Fender	97.6	100	94	99
10	Right Front Door	108.0	107	107	110
11	Center Panel Right				
12	Right Rear Door	103.0	106	100	103
13	Right Back Panel	120.1	159	103	98

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Small / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Crack - Damaged / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Dent - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : D
Remarks Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, no jack and tools, no spare tire, damaged rear bumper, missing right tail light, damaged headlight, battery weak, trunk hood issue