

General Information

Date & Time: 06, Aug, 2025 13:37

Make	Toyota	Model	Fortuner
YOM	2011	Odo Meter Reading	137,483
Registration No.	TBQ207	Chassis No.	MHFYZ59G504001437
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Brown		

Body / Panel Condition



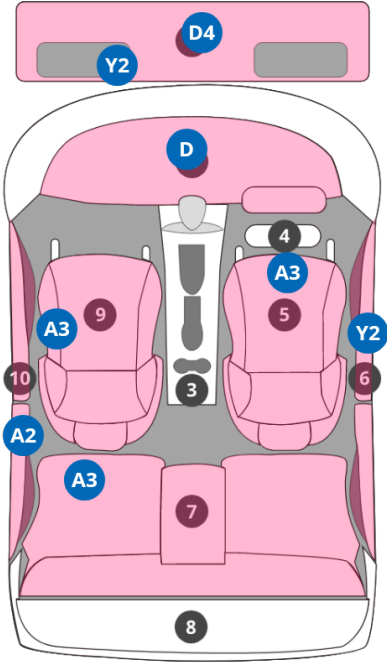
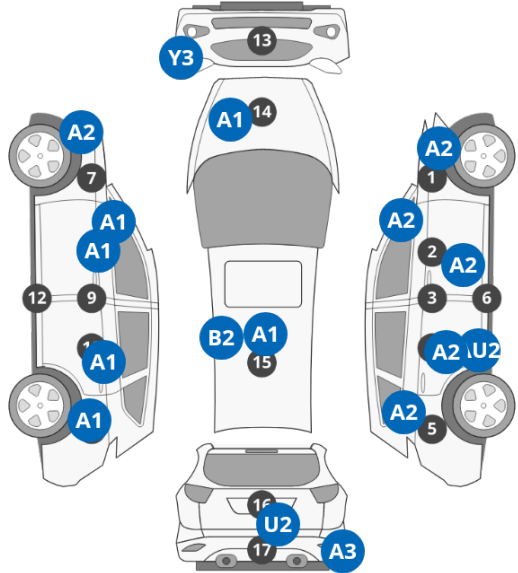
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	206.0	193	236	189
2	Boot Lid	340.3	159	694	168
3	Roof	127.2	118	118	163/110
4	Left Front Fender	170.3	190	192	129
5	Left Front Door	134.6	120	141	143
6	Center Panel Left				
7	Left Rear Door	137.3	134	137	141
8	Left Back Panel	170.3	183	165	163
9	Right Front Fender	192.6	264	165	149
10	Right Front Door	150.3	149	157	145
11	Center Panel Right				
12	Right Rear Door	144.3	143	139	151
13	Right Back Panel	202.0	290	163	153

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / (L) Front Seat - Cut, Crack - Medium / (R) Front Seat - Cut, Crack - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Cut, Crack - Small / Rear Seat - Cut, Crack - Medium / Sunvisor, Sunglass Holder - Grime - Small / Ceiling - Crinkle - Large / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Modified - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, plate light issue, air-con issue, yellowish and suncrack headlight, 4 wheel driveshifter cover missing, shift shock issue, power button on head unit issue, worn tires, 4 wheel drive shifter issue, rear emblem missing