

General Information

Date & Time: 08, Aug, 2025 14:06

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	64,564
Registration No.	CCC1098	Chassis No.	MHKAA1BC9PJ005304
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



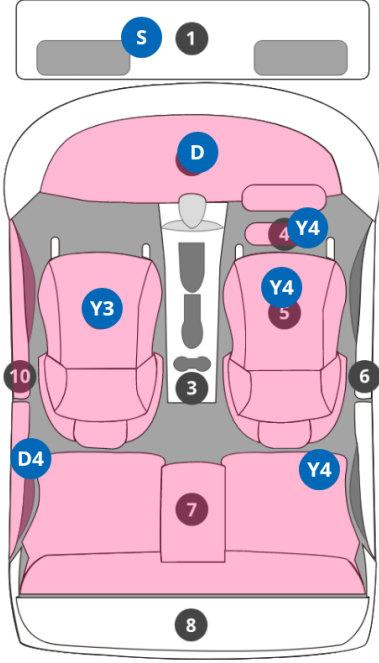
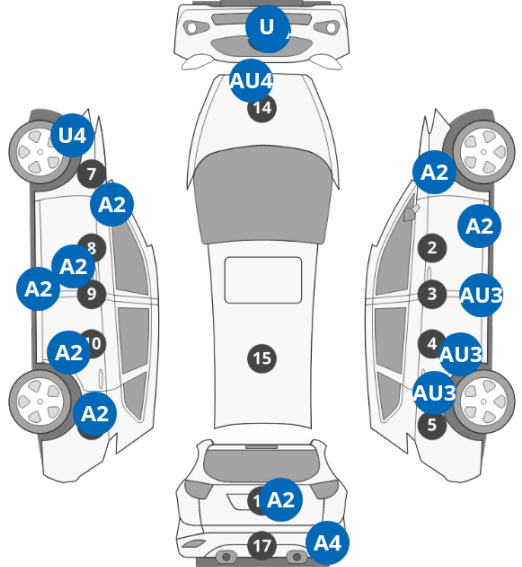
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	259.3	271	255	252
2	Boot Lid	86.6	84	90	86
3	Roof	84.8	84	91	84/80
4	Left Front Fender	524.0	962	328	282
5	Left Front Door	171.3	173	172	169
6	Center Panel Left				
7	Left Rear Door	146.6	171	138	131
8	Left Back Panel	89.4	93	87	89
9	Right Front Fender	305.6	285	273	359
10	Right Front Door	91.8	100	90	86
11	Center Panel Right				
12	Right Rear Door	87.5	81	86	96
13	Right Back Panel	82.9	85	85	79

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Grime - Large / Overall Interior - Smell - Yes / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / Trim Other - Worked - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Large / (L) Front Fender, Molding - Dent - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes

Inspector Notes
weak air-conditioning/ with warranty booklet/ n tools and jack/ with LTO plate/ possible flooding/ some parts repainted/ with spare tire