

General Information

Date & Time: 07, Aug, 2025 15:50

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	22,141
Registration No.	EAF5468	Chassis No.	MHKA4DE5FNJ017786
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



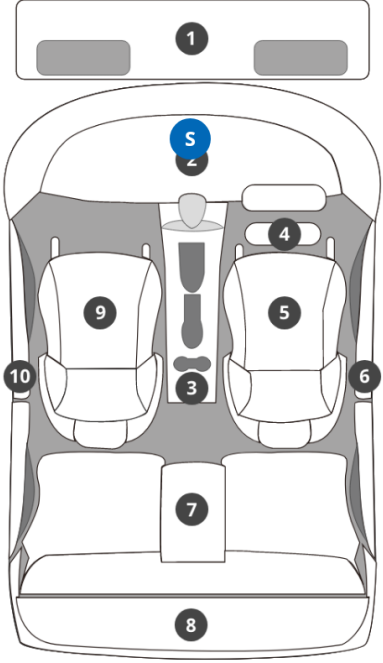
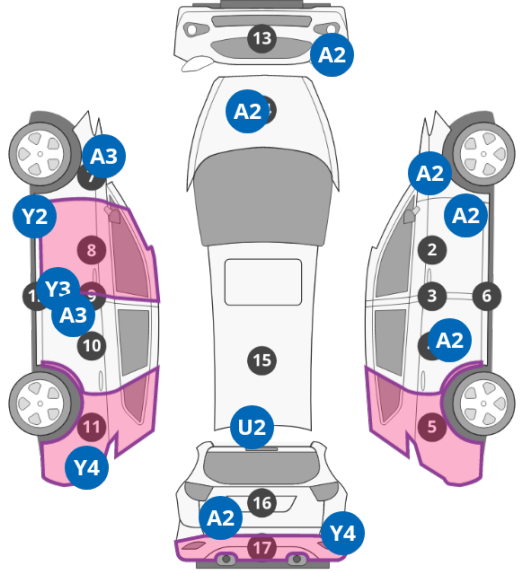
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.0	119	139	114
2	Boot Lid	95.8	95	98	94
3	Roof	92.2	89	101	97/82
4	Left Front Fender	86.6	79	89	92
5	Left Front Door	182.3	134	197	216
6	Center Panel Left				
7	Left Rear Door	88.9	89	85	93
8	Left Back Panel	89.7	97	88	85
9	Right Front Fender	93.8	98	93	91
10	Right Front Door	92.4	92	93	93
11	Center Panel Right				
12	Right Rear Door	105.0	110	102	103
13	Right Back Panel	175.3	233	144	149

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Overall Interior - Smell - Yes	Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Crack, Gap - Medium / (L) Step, In-panel, Side Spoiler - Crack, Gap - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Roof - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet and missing trunk floor mat/ with spare tire tools and jack/ with LTO plate/ loose shift knob