

General Information

Date & Time: 08, Aug, 2025 14:56

Make	Toyota	Model	Hiace
YOM	2019	Odo Meter Reading	108,322
Registration No.	NDN5609	Chassis No.	JTFJT02P4K5021999
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



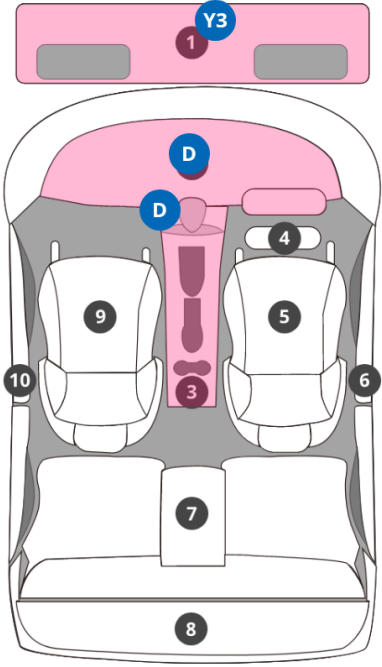
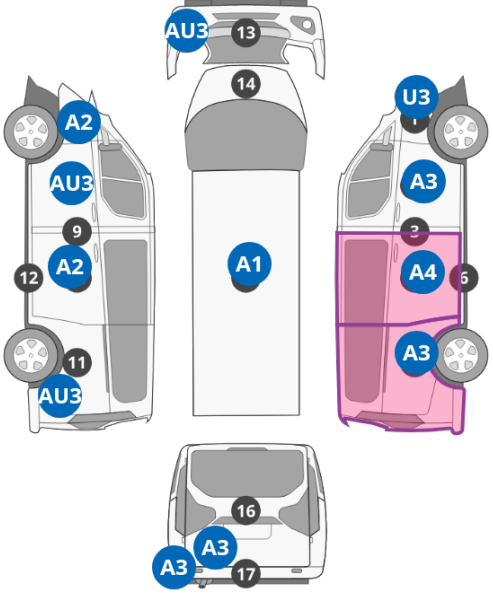
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	80.5	80	79	83
2	Boot Lid	217.1	437	98	116
3	Roof	61.5	65	67	53/62
4	Left Front Fender	83.1	85	84	80
5	Left Front Door	66.8	66	65	70
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	67.9	66	64	73
9	Right Front Fender	83.1	85	83	82
10	Right Front Door	62.3	67	57	63
11	Center Panel Right	72.7	89	69	60
12	Right Rear Door	71.9	93	63	60
13	Right Back Panel	75.3	72	71	84

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratched and cracked tail light, plate and park light issue, battery weak sun crack tail lights, scratches on headlight